

# Technical Service Bulletin

#### 72 Noise from center armrest

72 13 06 2016946/3 September 9, 2013. Supersedes Technical Service Bulletin Group 72 number 08-09 dated December 4, 2008 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A8	A8 2004 - 2006 All		Not Applicable	
A8	2007	000001 - 000388	Not Applicable	

#### **Condition**

REVISION HISTORY				
Revision	Date	Purpose		
3	-	Revised header data (Updated customer codes)		
2	12/4/2008	Revised title to include repair group		

The front center armrest makes creaking noises when the lid is pressed down with the weight of the customer's arm.

## **Technical Background**

The attachment points between the inner liner and the lower trim cause creaking under load.

#### **Production Solution**

Lubrication of the contact surfaces.

# Audi

# Technical Service Bulletin

#### **Service**

1. Use a thin brush to lubricate the attachment points between the inner liner and lower trim (Figure 1). Use special lubricant **G 060172A3.** 



**Figure 1.** The inner liner of the center armrest, removed. Yellow circles highlight the areas to be lubricated.

- 3. Remove any lubricant residue on the visible surfaces with all-purpose cleaner D 00940104.
- 4. Remove the lower trim to lubricate the contact surfaces (Figure 2 and Figure 3).



**Figure 2.** The mounting points into which the inner liner is slotted.



# Technical Service Bulletin



Figure 3. A mounting point of the lower trim.

5. Carefully check the Torx bolts (Figure 4) for tight fit.



Figure 4. A Torx bolt, which attaches the side trim.

# Audi

# Technical Service Bulletin

### **Warranty**

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.			
Service Number:	7220			
Damage Code:	0020			
Labor Operations:	Armrest remove and reinstall	7220 1900	20 TU	
	Armrest component lubrication and adjustment	7220 9999	20 TU	
Diagnostic Time:	GFF	No allowance	0 TU	
	Road test prior to service procedure	No allowance	0 TU	
	Road test after service procedure	No allowance	0 TU	
	Technical diagnosis at dealer's discretion			
	(Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)			
Claim Comment:	As per TSB #2016946/3			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## **Required Parts and Tools**

Part Number	Part Description	Quantity
D 00940104	All-purpose cleaner	Not to be billed on each case since only a small portion will be used. Charge as shop supplies.
G 060172A3	Special lubricant	Not to be billed on each case since only a small portion will be used. Charge as shop supplies.

### **Additional Information**

All parts and service references provided in this TSB (2016946) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.