

Technical Service Bulletin

70 A pillar trim is loose

70 13 34 2035687/1 November 4, 2013.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|-------------|-----------|----------------------------|
| Q7 | 2007 - 2014 | All | Not Applicable |

Condition

The A pillar trim on the right or left side of the vehicle is loose or does not fit properly.

Technical Background

The shape of the trim deforms over time.

Production Solution

Not applicable.

Service

1. Confirm that the trim is loose or ill-fitting. With the door open, the trim will likely appear as shown at right (Figure 1).



Figure 1. Loose A pillar trim.

Audi

Technical Service Bulletin

2. Replace the affected trim on one or both sides of the vehicle as necessary.

Tip: A single mounting screw is used to mount the A pillar trim. It runs through an adapter under the trim. The adapter also guides the wiring harness and sunroof drain hose. Alongside the adapter is the assembly support strap for the curtain airbag (Figure 2). When installing the new trim, make certain that this assembly support strap is not trapped or pinched between the adapter and the A pillar structure.

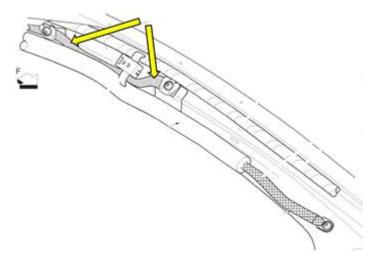


Figure 2. Location of the assembly support strap along the A pillar trim bracket.

Warranty

| Claim Type: | Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | | | |
|--------------------------------------------|-----------------------------------------------------------------------------------------------------------------------|--------------|-------|--|--|
| Service Number: | 7057 | | | | |
| Damage Code: | 0018 | | | | |
| Labor Operations: | A pillar trim remove and reinstall. | 7057 1900 | 30 TU | | |
| | -or- | | | | |
| | Both A pillar trim remove and reinstall | 7057 2000 | 50 TU | | |
| Diagnostic Time: | GFF | No allowance | 0 TU | | |
| | Road test prior to service procedure | No allowance | 0 TU | | |
| | Road test after service procedure | No allowance | 0 TU | | |
| Technical diagnosis at dealer's discretion | | | | | |
| | (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details) | | | | |
| Claim Comment: | As per TSB #2035687/1 | | | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



Technical Service Bulletin

Required Parts and Tools

| Part Number | Part Description | Quantity |
|-----------------------|---------------------------------------------------------------|------------------------|
| 4L0867233X XXX | Lining, pillar A - Left | 1 |
| 4L0867234X XXX | Lining, pillar A - Right | 1 |
| Use index and color v | variant specified in the parts catalogue according to the VIN | of the subject vehicle |

Additional Information

All parts and service references provided in this TSB (2035687) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.