

Technical Service Bulletin

90 "Ignition lock faulty" message in cluster information display

90 13 42 2035902/1 November 27, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2009-2015	All	Not Applicable
A5	2008-2015		
CAB	2010-2015		
Q5	2009-2015		

Condition

• "Ignition lock faulty" message is displayed in the driver information display with the symbol shown at right (Figure 1).



Figure 1. Symbol shown in driver information display.

- One of the following DTCs is stored in the comfort system central control unit, J393 (address word 46):
 - DTC 0003: Control unit 14 Faulty
 - DTC 3279: Clutch pedal switch for engine start (F194) 8 Implausible signal
 - DTC 0185: Activation for power supply relay (terminal 15) 7 Short circuit to ground
 - DTC 3282: Terminal 50 6 Short circuit to B+
 - DTC 3305: Wire for engine start request 6 Short circuit to B+
 - DTC 0526: Brake light switch 8 Implausible signal
 - DTC 0166: Access/start authorization switch (E415) 8 Implausible signal
 - DTC 0194: Ignition key removal lock 12 Electrical malfunction in circuit
 - DTC 0194: Ignition key removal catch 7 Short circuit to ground
 - DTC 0194: Ignition key removal catch 11 Open circuit

Technical Background

© 2013 Audi of America, Inc.

The "ignition lock faulty" message can be triggered by many different DTC entries. Presence of the message does not indicate that the ignition switch is faulty; the message typically has a different root cause. Replacing the ignition switch before completing GFF test plans typically does not correct the condition.

Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Production Solution

Not applicable.

Service

Complete all GFF test plans (automatically generated by ODIS) to ensure that the root cause is correctly determined and resolved.

Tip: Replace the ignition switch only if instructed to do so by GFF. If the switch has already been replaced and the condition is still present, contact TAC for further assistance.

Warranty

This TSB is informational only and not applicable to any Audi warranty.

Additional Information

All parts and service references provided in this TSB (2035626) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2013 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.