

Technical Service Bulletin



97 Coming / Leaving Home function intermittently does not work when unlocking doors with key

97 13 39 2013709/3 November 25, 2013. Supersedes Technical Service Bulletin Group 97 number 08-16 dated November 17, 2008 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6	2005 - 2006	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
3	-	Revised <i>Service</i> (Added old software part number to table) Revised <i>Warranty</i> (Revised entire table; updated claim type)
2	11/17/2008	Revised title to include Repair Group
1	12/8/2006	Original publication

- Coming Home / Leaving Home parked lighting function intermittently does not work when the doors are unlocked with the key remote.
- After the key has been operated twice in a row (multiple button depressions), the function works again.

Technical Background

There is a software timing issue in the vehicle electrical system control module, J519 (address word 09).

Production Solution

New software in the vehicle electrical system control module repairs the condition.

Service

SVM Update Instructions

1. Follow all instructions in the attached TSB, 2011732: *00 Software Version Management (SVM), operating instructions.*
2. Update the vehicle electrical system control module, J519 (address word 09), using the SVM action code as listed in the table below if necessary.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Action Code
A6	4F0910279A	All	4F0910279J	00240	NA4F97MY01
	4F0910279C				
	4F0910279F				
	4F0910279	All	4F0910279K		
	4F0910279D				
	4F0910279G				
	4F0910279B	All	4F0910279L		
	4F0910279E				



Tip: The SVM process must be completed in its entirety so the database receives the update confirmation response.

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	9710		
Damage Code:	0040		
Labor Operations:	Program driver side power supply control module	9710 2599	85 TU
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2013709/3		

Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732: *00 Software Version Management (SVM), operating instructions.*

All part and service references provided in this TSB (2013709) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.