

Technical Service Bulletin



66 License Plate Mounting Bracket Threaded Inserts Stripped

66 13 30 2030471/2 June 4, 2013. Supersedes Technical Service Bulletin Group 66 number 12-24 dated August 24, 2012 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
All Audi	2012 - 2015	All	Not Applicable

Condition

REVISION HISTORY		
Revision	Date	Purpose
2	-	Revised header data (added model years)
1	8/24/2012	Initial publication

Customer may report the license plate attachment screws do not install properly.

Technical Background

The license plate brackets are designed to be used with the appropriate length screw installed by hand with a screwdriver.

Damaged warranty parts have been returned to Audi of America with evidence of excessive torque used when installing the screw and/or excessive screw length (Figure 1).



Figure 1. Damaged screw inserts

Production Solution

Not applicable.

Service

The appropriate screw length is dependent upon the cumulative thickness of the license plate plus any decorative frame placed over the license plate.

Recommended screw length:

- License plate without decorative frame: M6 x 8 mm
- License plate WITH 2 mm thick decorative frame: M6 x 10 mm



Tip: Manually install the license plate screws using a handheld screwdriver. If the screw bottoms out, remove this screw and select a shorter screw instead of applying excessive torque. Otherwise, damage may occur to the license plate bracket screw inserts.

Warranty

This damage is due to outside influence and is not covered by any Audi warranty.

Required Parts and Tools

Not applicable.

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.