

Technical Service Bulletin



48 RS5 dynamic steering symbol warning

48 13 44 2033738/1 June 10, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
RS 5	2013	000001 - 902613	With electro-mechanical steering
RS 5 Cabrio	2013	000001 - 900407	With electro-mechanical steering

Condition

Customer may report a yellow warning symbol for dynamic steering in the instrument cluster.

Technical Background

On RS 5 models, there may be an angle difference in the active steering control module, J792 (address word 1B). There is no loss of steering functionality.

Production Solution

New software for J792:

- RS5 Cabriolet on 04.04.2013, from 8F 6D N 9000407
- RS5 Coupe on 27.03.2013, from 8T 1D A 902613

Service

1. Check DTCs in the environmental conditions of J792.
2. Confirm that DTC 03263 is stored and that it is accompanied with error code 114 or 105 in the *Measured values* section (Figure 1).

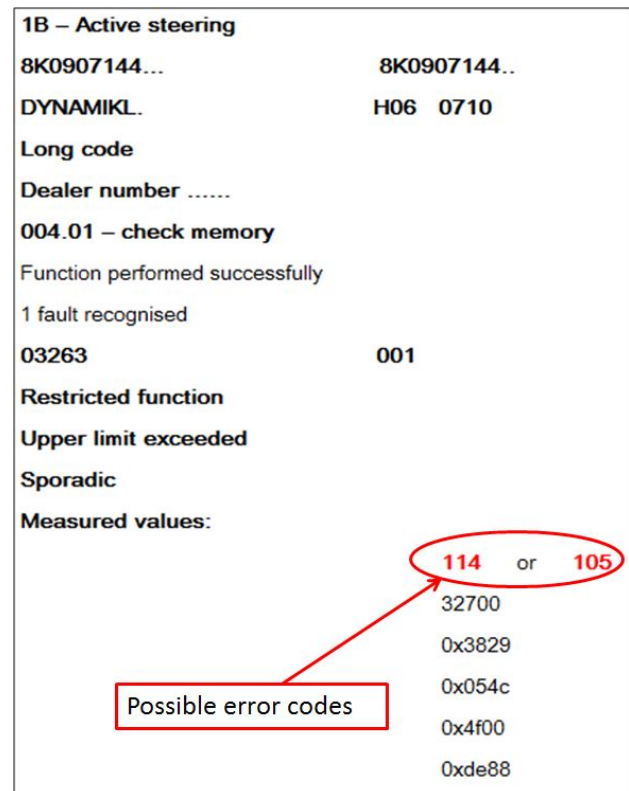


Figure 1. Example of DTC 03263 stored with error code 114 or 105 in the *Measured values* section.

3. Perform software update with SVM code 1BA003 (SW0720).

SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the active steering control module, J792, using the SVM action code as listed in the table below if necessary.

Model	Old Software Part Number	OLD Software Version	New Software Part Number	New Software Version	SVM Action Code
RS 5	8K0 907 144 J	0690	8K0 907 144 J	0720	1BA003
	8K0 907 144 K	0710	8K0 907 144 K		

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4835		
Damage Code:	0039		
Labor Operations:	Battery charge	2706 8950	10 TU
Diagnostic Time:	GFF – SVM update	0150 0000	Time stated on diagnostic protocol (Max 50 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2033738/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

The following Technical Service Bulletin may be necessary to complete this procedure:

- TSB 2011732: 00 Software Version Management (SVM), operating instructions

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.