

Technical Service Bulletin



43 Replaced adaptive damping suspension control module cannot be coded

43 13 19 2034162/1 June 17, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
S4	2009 – 2014	All	1BL – Adaptive Damping Suspension
S5	2008 – 2014		
RS5	2013 - 2014		
S4 CAB	2010 - 2014		
RS5 CAB	2013 – 2014		

Condition

The adaptive damping suspension control module, J250, cannot be coded via SVM spec/actual after it has been replaced.

Technical Background

A new generation of the adaptive damping suspension control module, J250, was placed into production. The new generation control module must be coded and parameterized using an SVM code, which is listed in the attached ETKA Parts Bulletin, 9-119. This parts bulletin can be found in the ETKA Remarks for the part number (Figure 1).

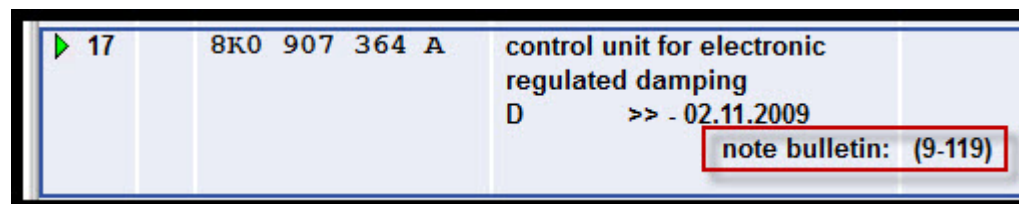


Figure 1. Parts Bulletin in ETKA.

Production Solution

Not applicable.

Technical Service Bulletin



Service

When replacing the adaptive damping suspension control module, J250, perform an SVM coding and parameterization using the provided SVM code.

The software version will not change because there is no software update.

Model	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version	SVM Action Code
S4	8K0907364	*	8K0907364 8K0907364A	*	XCHG14A001
	8K0907364A	*	8K0907364A	*	
	8R0907364	*	8R0907364 8R0907364B 8R0907364C	*	
	8R0907364B	*	8R0907364B 8R0907364C	*	
	8R0907364C	*	8R0907364C	*	
S5, RS 5	8K0907364	*	8K0907364 8K0907364A	*	
	8K0907364A	*	8K0907364A	*	
	8R0907364A	*	8R0907364A 8R0907364C	*	
	8R0907364B	*	8R0907364B 8R0907364C	*	
	8R0907364C	*	8R0907364C	*	
S5 CAB, RS 5 CAB	8R0907364A	*	8R0907364A 8R0907364C	*	
	8R0907364B	*	8R0907364B 8R0907364C	*	
	8R0907364C	*	8R0907364C	*	

Technical Service Bulletin



Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
Service Number:	4316		
Damage Code:	0040		
Labor Operation:	SVM documentation feedback	0150 0000	Time stated on diagnostic protocol (MAX 60 TU)
Diagnostic Time:	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB #2034162/1		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.



Merkblatt
Bulletin
Boletín
Boletín
Comunicazione
Meddelande
Mededeling



ersetzt	von	AUSGABE
ersätter	van	
remplace	de	
supersedes	di	
sostituisce	of	
sustituye	de	
vervangt	fran	08.12

Ausgabe	
Utgava	
Edition	
Issue	
Edizione	
Utgave	
08.12	

AUDI, I/VK-42	All
Martin Zäuner	

Gr. 9	Nr. 119
Gr.	No.

SVM code for electronically controlled damping control unit SDC J250

Model	Installed item part number	SVM code	Replacement item part number
Audi A4, A5, Q5	8R0 907 364 xx 8K0 907 364 xx	XCHG14A001	8R0 907 364 xx 8K0 907 364 xx

x = place marker

Input SVM code using VAS tester.

When the code will not execute, carry out actual/target comparison.