

Technical Service Bulletin

27 Cruise control sporadically does not work, set button jams

27 13 17 2033524/1 April 5, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4/S4/allroad (Ingolstadt)	2013	000001 - 204430	Not applicable
A4/S4 (Neckarsulm)	2013	000001 - 039674	Not applicable
A5/S5/RS5	2013	000001 - 057638	Not applicable
A5/S5 Cabriolet	2013	000001 - 011572	Not applicable
A6/S6/A7	2013	000001 - 110809	Not applicable
Audi Q5	2013	000001 - 066479	Not applicable

Condition

Customer Complaint:

- Cruise control deactivates sporadically or cannot be activated.
- A new set speed cannot be saved.
- 'Set' button on cruise control stalk does not work.

Workshop Findings:

One of the following DTCs is present in the vehicle:

- **DTC U111300** (Restricted function because of received error value) stored in engine control module, J623 (address word 01).
- **DTC P056800** (cruise control switch E45, implausible signal) stored in engine control module, J623 (address word 01).
- **DTC B115407** (CCS Switch mechanical malfunction) stored in steering column electronics control module, J527 (address word 16).

Technical Background

Incorrect tolerances of cruise control 'Set' button.

^{© 2013} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Technical Service Bulletin

Audi

Production Solution

Revised tolerances of cruise control 'Set' button.

Service

Replace the steering column multi-switch

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	2783				
Damage Code:	0010				
Labor Operations:	Remove / Reinstall Steering Wheel	4810 1900	40 TU		
	Replace Cruise Control Switch	2783 1950	30 TU		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 20 TU)		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure	No allowance	0 TU		
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance of				
Claim Comment:	As per TSB #2033524/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

© 2013 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Required Parts and Tools

Part Number	Part Description	Quantity
See ETKA	Steering Column Multi-Switch	1

Additional Information

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

Page 3 of 3

^{© 2013} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.