

## Technical Service Bulletin

#### 94 Water accumulation in front fog lights

94 13 04 2032891/1 February 4, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
A4 Ingolstadt	2013	000001-159700	Not Applicable	
A4 Neckarsulm	2013	000001-029370		
A5	2013	000001-160500		
A5 CAB	2013	000001-020000		

#### **Condition**

The customer complains that large amounts of water can be seen in the base of the fog lamp (Figure 1). No outside influence, such as rock chips, can be found. The fog lamps function normally.



**Figure 1.** Fog lamp with a significant amount of standing water at the base of the lens.

**Tip:** For customer complaints of only condensation buildup on fog lamp, refer to TSB 2012749 94 Exterior lights, moisture accumulation.

#### **Technical Background**

Under certain circumstances, water can enter through the ventilation opening on the back of the fog lamp.

# Audi

## Technical Service Bulletin

#### **Production Solution**

A new water-repelling element is installed on the ventilation opening on the back of the fog lamp.

#### **Service**

Replace the affected front fog lamp only if a visible amount of water can be seen as being pooled up at the base of the fog lamp.

#### **Warranty**

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.			
Service Number:	9464			
Damage Code:	0050			
Labor Operations:	Remove and install a single front fog lamp	9464 1900	30 TU	
	Adjust front fog lamp	9464 1600	20 TU	
	OR			
	Remove and install both front fog lamps	9464 2000	40 TU	
	Adjust front fog lamps	9464 1600	20 TU	
Diagnostic Time:	GFF	No allowance	0 TU	
	Road test prior to service procedure	No allowance	0 TU	
	Road test after service procedure	No allowance	0 TU	
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)			
Claim Comment:	As per TSB #2032891/1			

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.



## Technical Service Bulletin

### **Required Parts and Tools**

Part Number	Part Description	Quantity
8T0941699F	Left front fog lamp (A5, Cab)	as needed
8T0941700F	Right front fog lamp (A5, Cab)	as needed
8K0941699B	Left front fog lamp (A4)	as needed
8K0941700B	Right front fog lamp (A4)	as needed

#### **Additional Information**

All parts and service references provided in this TSB are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.