

# Technical Service Bulletin

#### 37 Gearbox malfunction message in cluster (DTC P0706)

37 13 10 2034863/1 July 31, 2013.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4	2013	FL*DA064356 - FL*DA129720 FL*DN007193 - FL*DN012613	With 0AW Transmission
A5 Cabriolet	2012-2013	FH*CN015183 - FH*CN015305 FH*DN001253 - FH*DN003856	With 0AW Transmission
A6	2012-2013	FC*CN175080 - FC*CN178909 FC*DN003139 - FC*DN043578	With 0AW Transmission

# Condition

- Customer may report that the gearbox warning message is on.
- DTC P0706 (driving mode sensor, implausible signal) is stored in the transmission control module (TCM), J217 (address 02).

# **Technical Background**

There is a reaction between the TCM and the automatic transmission fluid (ATF) in vehicles within a specific VIN range.

# **Production Solution**

Not applicable.

### **Service**

- 1. Drain the ATF according to the repair manual.
- 2. Replace the TCM according to the instructions in *Elsa* >> *Repair Manual* >> *Transmission* >> *Continuously* Variable Transmission Internal Components >> 38 Gears, Hydraulic Controls >> Removal and Installation >> Transmission Control Module J217.
- 3. Fill the transmission with ATF according to the repair manual.

#### © 2013 Audi of America, Inc.

Page 1 of 3

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



# Technical Service Bulletin

## Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.				
Service Number:	3730				
Damage Code:	0040				
Labor Operations:					
A6	Transmission Control Module Remove + Reinstall	3730 1900	220 TU		
A4 and A5 Cabriolet	Transmission Control Module Remove + Reinstall	3730 1900	190 TU		
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 30 TU)		
	Road test prior to service procedure	No allowance	0 TU		
	Road test after service procedure	0121 0004	10 TU		
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online	e for DADP allowance	e details)		
Claim Comment:	As per TSB #2034863/1				

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

# **Required Parts and Tools**

Part Number	Part Description	Quantity
Order to VIN # in ETKA Illustration 927-050	Control Unit For Automatic Transmission - Shiftless	1
G 052516A2	Automatic Transmission Fluid	7

<sup>© 2013</sup> Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

**Technical Service Bulletin** 



## **Additional Information**

All parts and service references provided in this TSB (2034863) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2013 Audi of America, Inc.

Page 3 of 3

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.