

01 MIL on (DTC P2006(00) or P2007(00))

01 13 26 2033919/10 August 29, 2013. Supersedes Technical Service Bulletin Group 01 number 13-20 dated August 2, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A6, A7, S4, S5, S5 Cab, Q7, Q5	2013	All	3.0 FSI Engine

Condition

REVISION HISTORY				
Revision	Date	Purpose		
10	-	Revised Service (Added Tips)		
9	8/2/2013	Revised Service (Added steps)		
		Revised Warranty (Updated labor operations)		
8	7/19/2013	Revised Required Parts and Tools (Updated part numbers)		
7	7/9/2013	Revised header data (Added model year)		
6	6/26/2013	Revised Service (Replace both actuators)		
5	6/18/2013	Revised Required Parts and Tools (Updated quantity)		
4	6/7/2013	Revised Service (Removed step regarding calling TAC)		
3	5/29/2013	Revised header data (updated engine codes)		
2	5/28/2013	Revised Service (Added steps and image)		
1	5/16/2013	Initial publication		

MIL on.

- One or both of the following DTCs is stored in the engine control module, J623 (address word 01):
 - DTC P2006(00) (Intake Manifold Runner Control Stuck Closed, Bank 1).
 - DTC P2007(00) (Intake Manifold Runner Control Stuck Closed, Bank 2).
- There may be slight power reduction at high RPMs.

© 2013 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Background

One of the vacuum actuators on intake runner bank 1 or bank 2 is defective. It is possible that the membrane on the vacuum actuator may tear. As a result, the intake manifold flaps do not function.

Production Solution

Updated vacuum actuator.

Service

 Ensure that the fault is not caused by a defective vacuum line by using the vacuum pump (Figure 1) to confirm there is no leak in the vacuum supply to the actuators.

The vacuum lines are working correctly if they are able to maintain vacuum while the actuators are disconnected and the lines are plugged up.

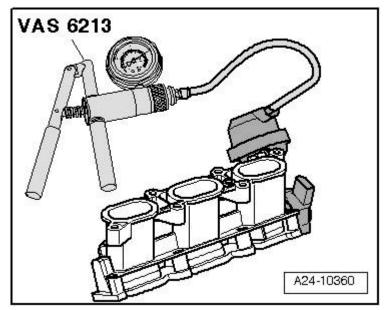


Figure 1. Vacuum pump VAS 6213

2. After confirming that the fault is not due to defective vacuum lines, replace **both** vacuum actuators (bank 1 and bank 2 actuator) by following the instructions below. Both actuators must be replaced in order to prevent any repeat repairs.

© 2013 Audi of America, Inc.

Page 2 of 11

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Replacing the passenger side vacuum actuator

1. Unclip the secondary air injection line from the bracket (Figure 2, 1) and disconnect the coupling (Figure 2, 2) by pushing both release tabs at the same time (one in the front one in the back).

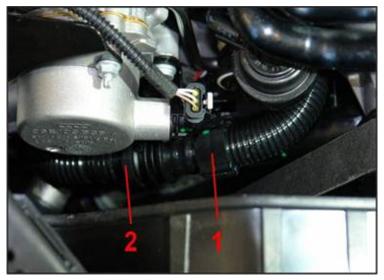


Figure 2. Bracket (1) and coupling (2) to disconnect from the secondary air injection line

2. Remove the intake manifold runner position sensor by using a ball head torx bit to remove the screws (Figure 3, arrows).

UNote:

To prevent the sensor from falling, do not disconnect the connector.

Tip: Place a shop rag under the screws to catch any screws that drop.

Tip: To prevent losing the screws, use a non-bonding adhesive on the tip of the ball torx bit and use a magnet to hold them during removal.

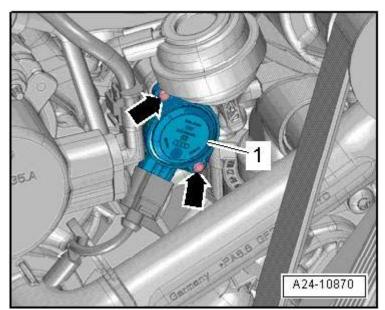


Figure 3. Intake manifold sensor (1) and bolts (arrows)

© 2013 Audi of America, Inc.

Page 3 of 11

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



i

Tip: The T10 ball head torx bit is sourced locally (Figure 4). Examples include: Snap-on Tools SDM32KT or SDMBT10, or VIM Tools VIS108 or VIS112.



Figure 4. T10 ball head torx bit.

Figure 5. Vacuum hose (1), vacuum actuator (2), and ball head (3)

4. Reinstall the new actuator by following the above steps in reverse order.

Page 4 of 11

3. Disconnect the vacuum hose (Figure 5, 1), then pry the vacuum actuator (Figure 5, 2) off of the ball head (Figure 5, 3).

^{© 2013} Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Replacing the driver side vacuum actuator

- 1. Raise the vehicle and remove the front noise insulation panel.
- Remove the screw (Figure 6, arrow) from the coolant line and upper section of oil pan. This will allow the coolant lines to be moved out of the way when removing the sensor.

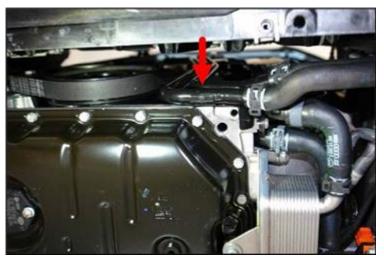


Figure 6. Screw to be removed from coolant line and upper section of oil pan (arrow)

- 3. Place the drip tray for workshop crane VAS 6208 under the engine.
- 4. Disconnect the following (Figure 7):
 - Charge air pressure sensor
 - Engine coolant temperature sensor
 - Camshaft position sensor
 - Solenoid valve

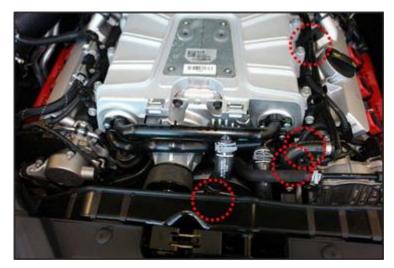


Figure 7. Sensors and valve that need to be disconnected are circled in red.

5. Lay the wiring harness aside.

^{© 2013} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



6. Disconnect the vacuum hose (Figure 8, arrow) from the vacuum pump and lay it aside.

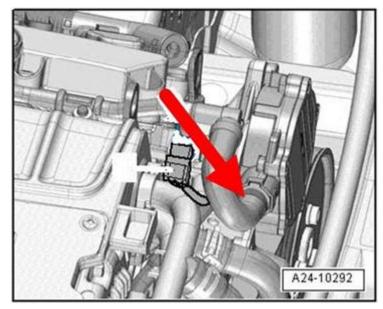


Figure 8. Vacuum hose (arrow)

7. Remove the bolt as shown in the image at right (Figure 9, 2)

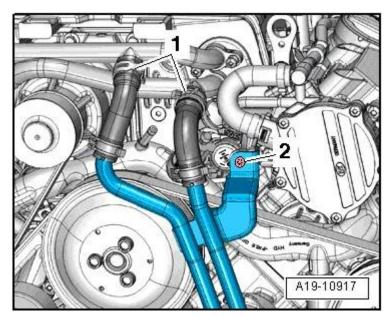


Figure 9. Bolt to be removed (2)

© 2013 Audi of America, Inc.

Page 6 of 11

all rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Audi

 Remove coolant hoses (Figure 10, arrows) and close them off with fitting caps (yellow caps from VAS 6122). Move the coolant hoses to the side for access to the intake runner position sensor.



Figure 10. Coolant hoses (arrows)

- 9. Collect any coolant that is draining.
- 10. Remove the intake manifold runner position sensor by using a ball head torx bit to remove the bolts. To ensure good torx bit to bolt head contact, apply force in the direction of the arrow (Figure 11, arrow).

UNote:

© 2013 Audi of America, Inc.

To prevent the sensor from falling, do not disconnect the connector.

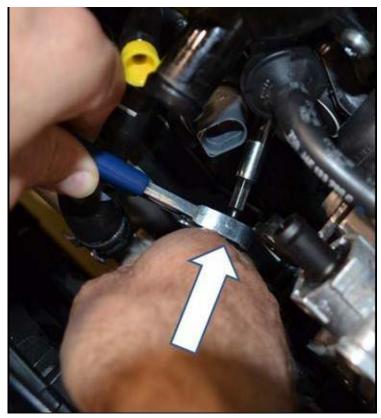


Figure 11. Apply force in the direction of the arrow.

Page 7 of 11

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Audi

Tip: Place a shop rag under the screws to catch any screws that drop (Figure 12).



Figure 12. Place a shop rag under the screws.

Tip: To prevent losing the screws, use a non-bonding adhesive on the tip of the ball torx bit and use a magnet to hold them during removal (Figure 13).



Figure 13. Use a magnet (arrow) to hold the screws during removal.

© 2013 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



11. Pry the vacuum actuator (Figure 14, 2) off of the ball head (Figure 14, 3), then disconnect the vacuum hose (Figure 14, 1).

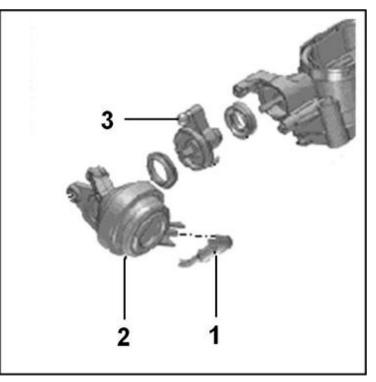


Figure 14. Vacuum hose (1), vacuum actuator (2), and ball head (3)

- 12. Reinstall the new actuator by following the above steps in reverse order.
- 13. Top off coolant, if necessary.

all rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.

Audi

Technical Service Bulletin

Warranty

Claim Type:	Use applicable claim type Service Bulletin is informa		any warranty, this Technical
Service Number:	2464		
Damage Code:	0010		
Labor Operations:	Both vacuum actuators remove+reinstall	2464 2099	90 TU
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (max 20 TU)
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	0121 0004	10 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
Claim Comment:	As per TSB # 2033919/10		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part number	Part Description	Quantity
06E133159M	Actuator left	1
06E133159N	Actuator right	1
G 012A8G1G	Coolant top-off	0.3
N 10201801	Clamp	1

Tool Number	Tool Description	
VAS 6213	Vacuum pump	
VAS 6122	Coolant hose cap-off set	

^{© 2013} Audi of America, Inc.

Page 10 of 11

all rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Additional Information

All parts and service references provided in this TSB (2033919) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2013 Audi of America, Inc.

Page 11 of 11

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.