

Technical Bulletin

Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
Golf,GTI, Jetta SportWagen	2010 - 2013	All	All	All	All
Jetta Sedan	2011 - 2013	All	All	All	All
Passat	2012 – 2013	All	All	All	All

Condition

69 13 01 February 11, 2013 **2029767** Supersedes T.B. V691202 dated October 2, 2012 to include additional model.

Airbag Warning Lamp Illuminated in Instrument Cluster, DTC B101614 Stored in Airbag Control Module

Technical Background

Airbag lamp in instrument cluster may illuminate due to unfastened connector for passenger airbag warning lamp.



Symptom as described will not affect airbag functionality.

Production Solution

Information only.

Service

Procedure

- Verify airbag indicator lamp in instrument cluster is ON.
- Using GFF, scan vehicle for DTCs.
- Verify DTC B101614 is stored in airbag module.

Fault Code	Description
	Front passenger airbag disabled indicator lamp interruption/short - circuit to ground



If any other faults are present in airbag module, further diagnosis is required.

Das Auto

3409

Technical Bulletin

- If DTC is present, clear fault memory and recheck for code.
- If fault clears, and the airbag indicator in the instrument cluster does not illuminate, no repairs necessary.
- If DTC reoccurs, remove center console cover using wedge tool 3409, inspect wiring connections to "PASSENGER AIR BAG WARNING LAMP" (see figures 3 and 4), for loose connection.
- Secure wiring connections as necessary.
- If connection is secure, further diagnosis is needed. This technical bulletin does not apply.
- Clear DTCs again and retest operation to verify airbag lamp is OFF in instrument cluster.

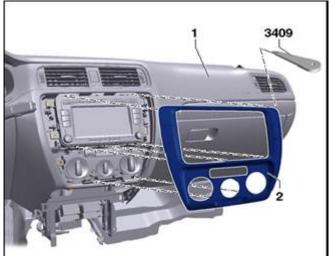








Figure 3 Figure 4

Technical Bulletin

Warranty

Model(s)	Year(s)	Eng. Code(s)	Trans. Code(s)	VIN Range From	VIN Range To	
Golf, GTI, Jetta SportWagen	2010 - 2013	All	All	All	All	
Jetta Sedan	2011 - 2013	All	All	All	All	
Passat	2012 – 2013	All	All	All	All	
		SAG	A Coding			
Claim Type:			Use applicable Claim Type 1)			
Service Number:	Damage Code		нѕт	_	ion (Depends or ice No.)	
6982	0015				e when indicated Web (L/R)	
Parts Manufacturer	Golf, GTI			w	WWO ²⁾	
	Jett	a Sedan, Jetta Sp	ortWagen	31	ME ²⁾	
	Passat			Т	Tx6 ²⁾	
Labor Operation 3): Remove and Install Center console trim, reconnect passenger airbag warning lamp harness connector.			69824199 = 20 TU (loose connection found)			
Causal Part: Select labor operation			69824199			
		Diagno	ostic Time ⁴⁾			
GFF Time expenditure		01500000 = 20 TU max.		Y	YES	
		01210002 01210004		1	NO	
Technical Diagnosis 0132xxxx = 00 T		J max. NO		NO		



Technical Bulletin

- 1) Vehicle may be outside any Warranty in which case this Technical Bulletin is informational only
- ²⁾ Code per warranty vendor code policy.
- 3) Labor Time Units (TUs) are subject to change with ELSA updates.
- ⁴⁾ Documentation required per Warranty Policy Procedures Manual.

Required Parts and Tools

No special parts required.

Tool Description	Tool No:	
Wedge Tool	3409	
Midtronics Battery Tester/Charger	InCharge 940 (INC-940)	
VAS Diagnostic Tool	VAS-PC, 5051B, 5052A, 6150X	
	(Base CD V19.01.00 and Brand DVD V19.19.00 or higher)	

Additional Information

All part and service references provided in this Technical Bulletin are subject to change and/or removal. Always check with your Parts Dept. and Repair Manuals for the latest information.