



Bulletin No.: PI0531B

Date: Jul-2013

Service Bulletin

PRELIMINARY INFORMATION

Subject: Transmission Over Temperature, Malfunction Indicator Lamp (MIL) Illuminated, DTC U0101 Set (Inspect Transmission Cooler Lines)

Models: 2011-2013 Chevrolet Silverado
2011-2013 GMC Sierra
Equipped with 6L90 (RPO MYD) Automatic Transmission


This PI has been revised to add the 2013 model year. Please discard PI0531A.

Condition/Concern

Some customers may comment that the driver information center (DIC) will display "TRANSMISSION HOT - Idle Engine"; or the MIL is illuminated and a technician may find DTC U0101.

Recommendation/Instructions



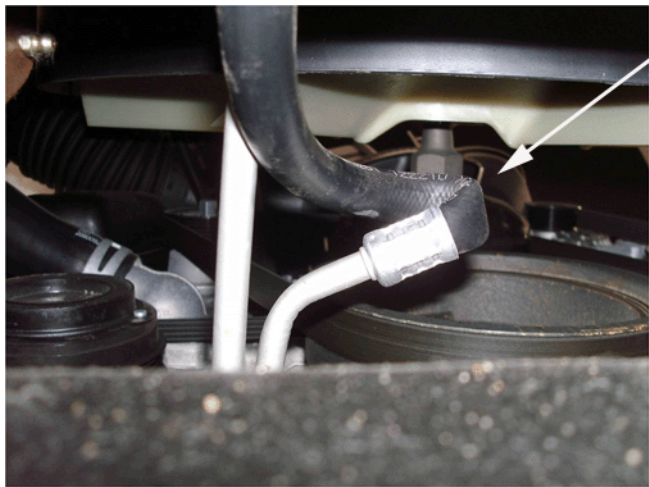

This condition may be caused by twisted or kinked transmission oil cooler lines. Inspect the transmission oil cooler lines near the radiator for any twists or kinks. Correct as required.

If twisted or kinked cooler lines are found, the transmission fluid level and condition should be checked for signs of distressed fluid. Remove the transmission fluid pan assembly to inspect for signs of internal distress.

If no twist or kink is found in the cooler lines or a concern of distressed fluid, refer to SI for further diagnostics for the condition.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION