Service Bulletin

Bulletin No.: Pl0954

Date: Apr-2013

PRELIMINARY INFORMATION

Subject: Service Suspension Message With Any Malfunction Codes C0595, C0600, C0605, C0670 or C0675 with

Symptom 0A After Accelerometer Replacement

Models: 2010 Buick LaCrosse

Equipped with RPO F45

Built Prior to January 31, 2010

Condition/Concern

Service Suspension Message with any malfunction codes C0595, C0600, C0605, C0670 or C0675 with Symptom 0A after Accelerometer replacement.

Replacement accelerometers are incompatible with the OE Controller. When replacing any of the 5 vehicle accelerometers, the controller must also be replaced. The new controller is compatible with both OE and Service accelerometers.

Recommendation/Instructions

Replace the Suspension Control Module.

Parts Information

Part Number	Description
20923493	Module, Electronic Suspension Control

Warranty Information

For vehicles repaired under warranty, use:

Labor Operation	Description	Labor Time
E5911	Electronic Suspension Control Module Replacement	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION