



Countries:	AUSTRALIA, BRAZIL, CANADA, UNITED STATES, SOUTH AFRICA	Document ID:	IK1200416
Availability:	ISIS, FleetSIS, Body Builder	Revision:	4
Major System:	ENGINES	Created:	10/27/2009
Current Language:	English	Last Modified:	10/25/2013
Other Languages:	Français , Español .	Author:	Charles Schroeder
Viewed:	2165		

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 299	Not Helpful 584
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	---------------------------	-------------------------------

Title: Dual Throttle Pedal Harness Troubleshooting

Applies To: 7000 4000 Models with Dual Throttle Harness and Switch Installed.

DESCRIPTION

Dual throttle pedals are inoperative.

SYMPTOMS

- Will not accelerate
- Check engine light on

POSSIBLE DIAGNOSTIC TROUBLE CODES

DTC	MODULE	DESCRIPTION
134	Engine	APS/IVS conflict


TROUBLESHOOTING

1. Remove dash panel and inspect wiring on switch.
2. Refer to [TSI 10-08-01](#). With a dual pedal set up, the **NEW STYLE SENSOR** listed in the **TSI WILL NOT WORK**.

SERVICE PROCEDURE

1. Check the wires on the back of the selector switch
2. Verify that wire 99B is in cavity B
3. Verify that wire 99D is in cavity E
4. If these are incorrect please swap the two wires.
5. If these wires are in the correct locations please follow the correct Iknow article for the aps troubleshooting.

CIRCUIT DIAGRAM

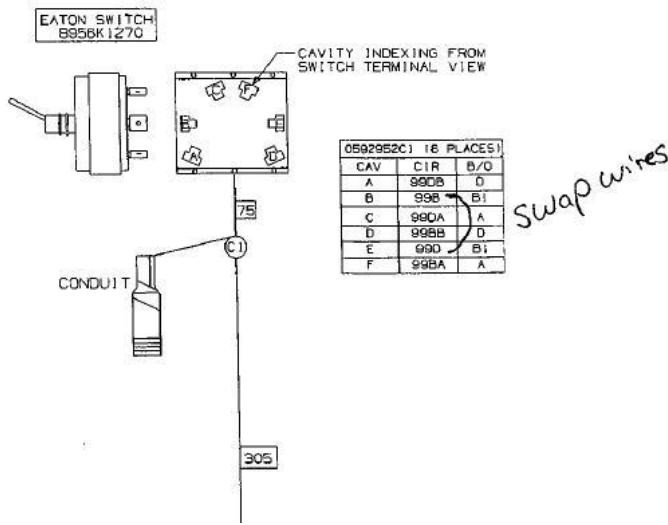

Hide Details

Feedback Information

Viewed: 2164
 Helpful: 299
 Not Helpful: 584

No Feedback Found