



Countries:
Availability:
Major System: ENGINES
Current Language: English
Other Languages: NONE
Viewed: 35

Document ID: IK1200992
Revision: 0
Created: 10/22/2013
Last Modified: 10/27/2013
Author: Bob Ford

[Less Info](#)
[Hide Details](#)

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 0	 0

Title: RE Model Hydraulic Reservoir Fluid Sight Tube

Applies To: RE Model School and Commercial Bus, PB30500, PC30500

DESCRIPTION


The following information should be used to properly repair or replace the RE Model School or Commercial Bus hydraulic reservoir fluid level sight tube.

SYMPTOMS


- Leaks
 - Cracked Tubing
 - Tubing Incorrect Length
 - Damaged Ferrule or Insert

REPAIR PROCEDURE

Sight tube leaks need to be repaired based on condition found during inspection. Verify fitting, fitting ferrule, tube insert and tube are not damaged and replaced as required. Verify tube length is 130mm (Approximately 5 1/8" long). Final installation of the fitting and tube assembly will result in the fittings slightly angled. During assembly, ensure tube is fully seated in the fitting prior to tightening sequence. Tighten nut by installing finger tight and then wrench tighten 1-3/4 to 2 turns to preset ferrule.

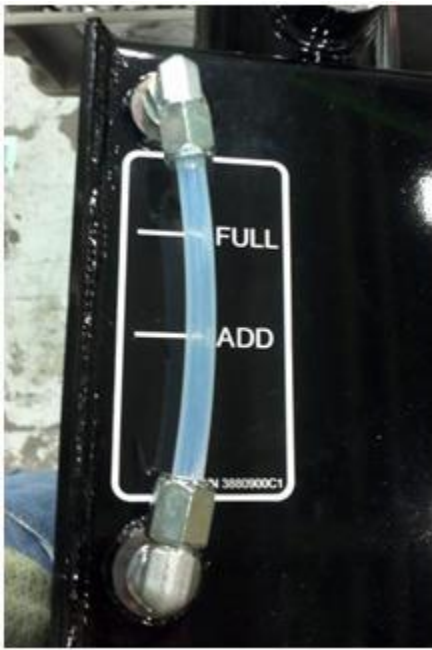

PARTS INFORMATION

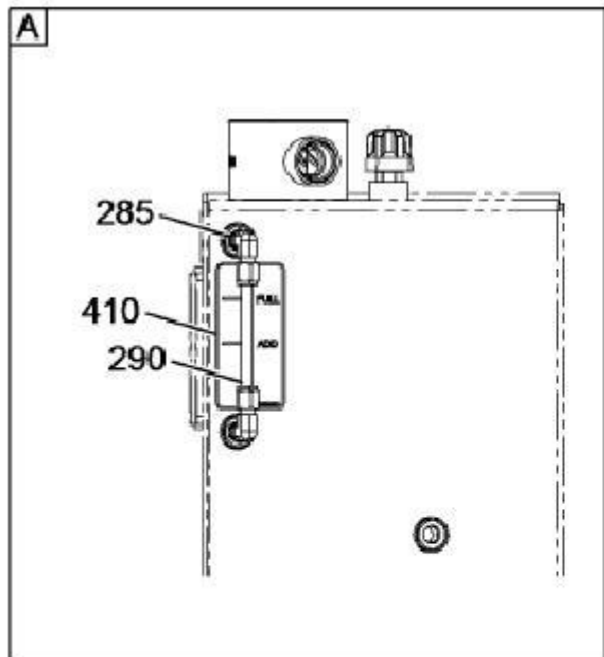

Item	Part Number	Description
285	3880893C1	ADAPTER -06 ORB X 3/8 TUBE 90
285	3880894C1	TUBE INSERT 3/8
290	3809065R1	TUBING CLEAR 3/8"
410	3880900C1	PRODUCT GRAPHIC,LABEL OIL LEVEL

 Hide Details

Feedback Information

Viewed: 34

Helpful: 0

Not Helpful: 0

No Feedback Found

Copyright © 2013 Navistar, Inc.