



Countries: AUSTRALIA, BRAZIL, CANADA,
UNITED STATES, MEXICO,
SOUTH AFRICA

Availability: ISIS, Bus ISIS, FleetISIS, Body
Builder

**Major
System:** BRAKES

**Current
Language:** English

**Other
Languages:** NONE

Viewed: 607

**Document
ID:** IK1300085

Revision: 4

Created: 5/19/2011

**Last
Modified:** 10/9/2013

Author: Anthony
Kelso

[Less Info](#)[Hide Details](#)

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 11	 2

Title: Wabco FPB/ Quadraulic Brake Lining Replacement and uneven wear

Applies To: CE, BE, Durastar

DESCRIPTION

During service of FPB Quadraulic Caliper Brake Linings and for uneven lining wear **greater than 1/4"** between inner and outer pad on the same wheel end it is recommended to use OEM material , MA707 or MA708 (based on GVWR / application, see parts by vin), and service **must** include replacement of the wear plates and retainer anti-rattle spring. Both sides will need to be serviced at the same time (service by axle). Clean plate mating surfaces prior to installation.

A revised brake lining kit will now include wear plate hardware

PARTS INFORMATION

Part #	Description	Qty.
2599723C92	Brake Lining Kit MA708	1 set
2599722C92	Brake Lining kit MA707	1 set

[Quadraulic Brake Service Manual](#)

[Hide Details](#)

Feedback Information

Viewed: 606
Helpful: 11
Not Helpful: 2

No Feedback Found