



Countries: CANADA, UNITED STATES, PUERTO RICO
Availability: ISIS, FleetISIS
Major System: EXHAUST
Current Language: English
Other Languages: NONE
Viewed: 241

Document ID: IK0700047
Revision: 1
Created: 6/28/2012
Last Modified: 12/10/2013
Author: Keith Kierzek

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 10	Not Helpful 1
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	-----------------------------

Title: Horizontal Aftertreatment Mounting Bolt Torque

Applies To: ProStar, TranStar, WorkStar equipped with MF 11/13 engines

DESCRIPTION

Horizontal Aftertreatment Mounting bolt loose

SYMPTOMS

Horizontal Aftertreatment Support Rod Bolt loose or backed out of Aftertreatment Support Hanger Rod.

PARTS INFORMATION

Part #	Description	Qty.
3536430C1	bolt	As Required

TROUBLESHOOTING

1. Inspect for Support Rod Bolt to be loose or backed out of Support Rod
2. If loose inspect bolt for wear and replace if necessary

RESOLUTION

Torque Support Rod Bolt to 88-108 NM / 65-80 Ft. Lbs.



 Hide Details

Feedback Information

Viewed: 240
Helpful: 10
Not Helpful: 1

No Feedback Found