



Countries:	CANADA, UNITED STATES, PUERTO RICO	Document ID:	IK0700059
Availability:	ISIS, FleetSIS	Revision:	1
Major System:	EXHAUST	Created:	5/1/2013
Current Language:	English	Last Modified:	12/10/2013
Other Languages:	NONE	Author:	Keith Kierzek
Viewed:	711		

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 7	Not Helpful 0
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	-------------------------	-----------------------------

Title: DEF Tank Slow to Fill

Applies To: 2013 Cummins ISX 15L

 
DESCRIPTION

When filling a DEF tank with a high volume dispenser you may experience a backslash of fluid from the fill neck.



REPAIR PROCEDURE

1. Inspect DEF tank vent and verify it is clean and free of debris.
2. Remove DEF tank cap to expose filler neck.





3. Remove filler neck insert by rotating counter clockwise to release.



4. Grasp insert tab with a pair of pliers and gently remove the insert.



 


- See images below for removed insert.




Screen Removal:

1. Snip four attachment posts at base of insert with a pair of side cutting pliers






2. Trim Screen from insert using a box cutter or suitable knife.

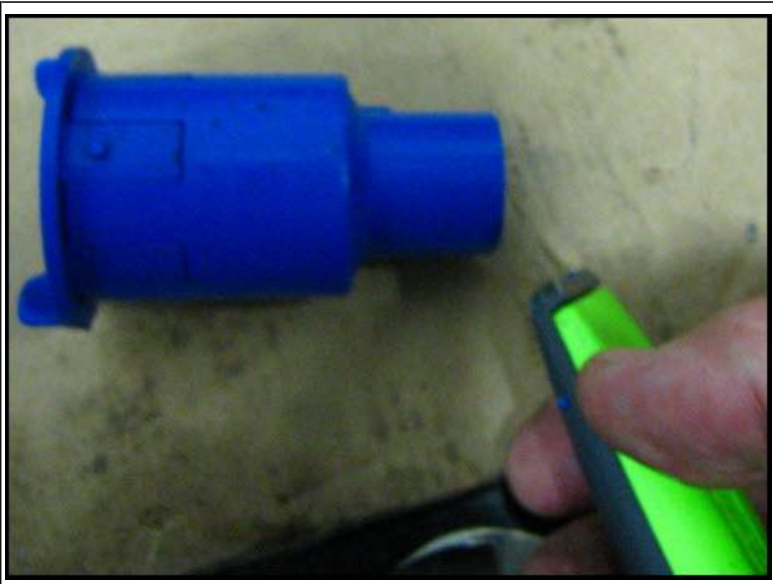


 3. Once screen is trimmed from insert, clean the insert with soap and water to remove any debris remaining from the trimming process; dry insert thoroughly.





4. Reinstall insert into filler neck.

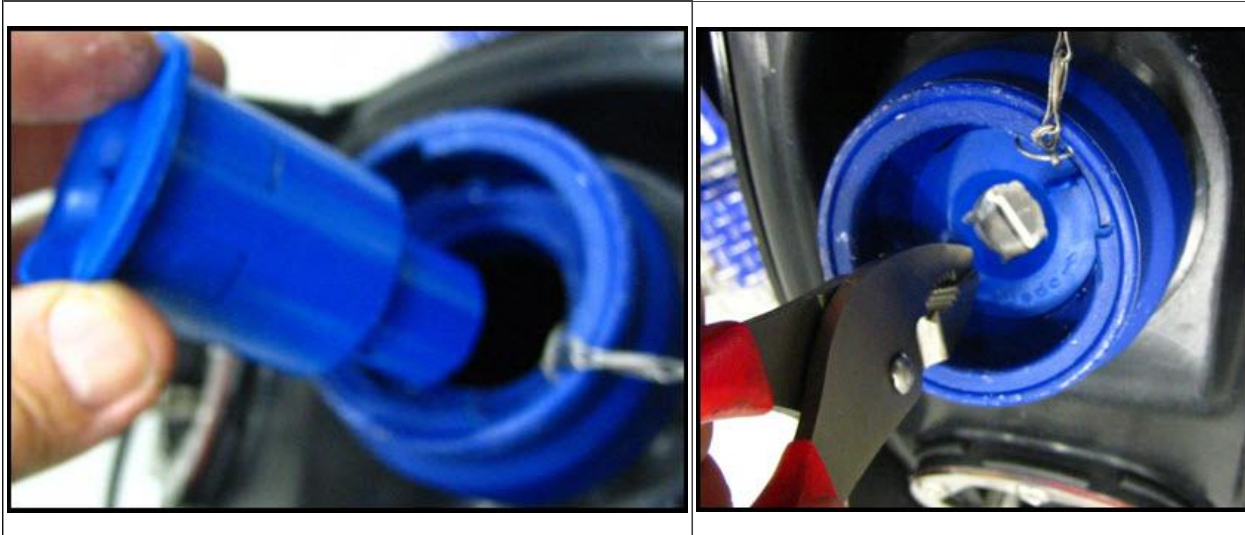

 Hide Details

Feedback Information

Viewed: 710
Helpful: 7
Not Helpful: 0

No Feedback Found