



Countries: CANADA, UNITED STATES, PUERTO RICO
Availability: ISIS, FleetISIS, Body Builder
Major System: ELECTRICAL SYSTEM
Current Language: English
Other Languages: [Français](#), [Español](#)
Viewed: 372
Document ID: IK0800246
Revision: 4
Created: 9/10/2010
Last Modified: 12/6/2013
Author: Will (Mark) Wiley

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 14	Not Helpful 1
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	-----------------------------

Title: Manual Mode Button on the Eaton Shift Console is flashing with No Active Codes in the TCM. With Active Code 3655, 3654 or 3656 in the Body Controller.

Applies To: ProStar/LoneStar with Eaton Ultra and Auto Shift Transmissions

DESCRIPTION

On ProStar and LoneStar units the steering wheel switch on the right hand side has a built in up shift and down shift buttons. If you have a 3654, 3655, 3658 or 3656 active in the BC, and no active codes in the TCM, replace the switch and test.

If you unit was not built with up/down shift buttons, refer to [IK0800465](#)

SYMPTOMS

- Manual mode button on the Eaton shift console flashing. No TCM active codes.

POSSIBLE DIAGNOSTIC TROUBLE CODES

DTC	MODULE	DESCRIPTION
3654	Body Controller	The Steering Wheel Manual Switch is Stuck
3655	Body Controller	The Steering Wheel Shift Up Switch is Stuck
3656	Body Controller	The Steering Wheel Shift Down Switch is Stuck
3658	Body Controller	The Steering Wheel Switch Voltage input 0 or Debounced Switch Voltage 0

Hide Details

Feedback Information

Viewed: 371
 Helpful: 14
 Not Helpful: 1

No Feedback Found