

SP13-11: VALVE AHI ERREUR PPID 329 REV A - Feb 2013

Ref: production retrofit 13005 ON STOCK VEHICLES

SEE VEHICLE LIST IN SAP

CHECK THE PRESENCE OF ERROR CODE PPID 329 ON DASHBOARD

IF THERE IS AN ERROR,
CHECK THE MANUFACTURING DATE ON THE VALVE. If **LESS THAN 12 W 335 0141 (See below in red)**

REPLACE THE AHI VALVE (AFTER TREATMENT HYDROCARBON INJECTOR)

For vehicles that have the code with another PPID329 FMI CODE, investigate case by case, as usual.

To be installed, replacement p/n 21534115 VALVE SHOULD HAVE A MANUFACTURING CODE OVER 12 W 335 0141

12 YEAR
W33 WEEK
DAY 5
0141 SERIAL NUMBER OF THE DAY

THE CODE IS UNDER REMOVABLE AIR INLET COVER
SEE PICTURE

PLS RETURN PARTS FOR ANALYSIS

IF POSSIBLE LET THE VEHICLE COOL DOWN DURING A NIGHT AND Recheck GOOD WORKING ORDER OF THE VALVE REPLACED.

RECORD VALVE SERIAL NUMBER IN THE RO;


VBC Campaign: n/a

Fail code: 01.00-2

Decect code: 9

System Condition: B

Causal p/n: 21534115

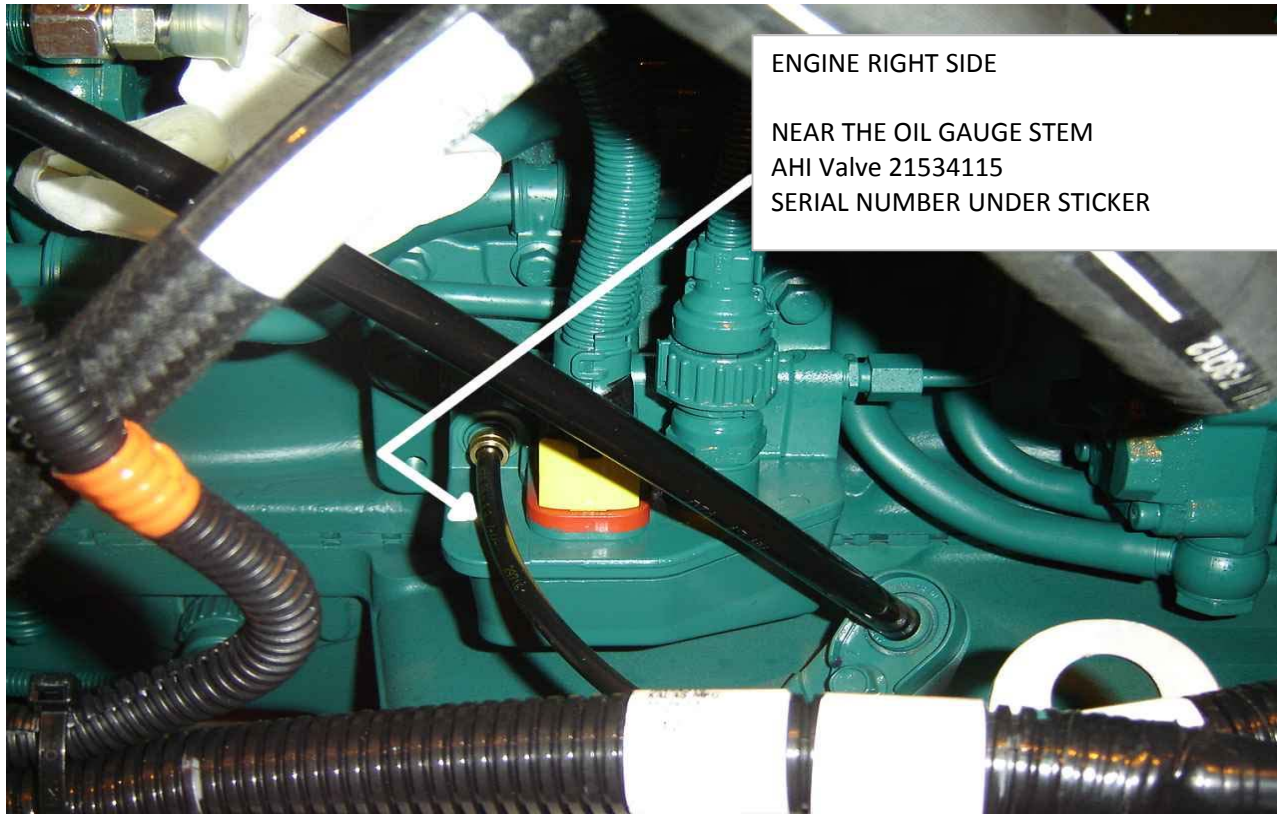


ENGINE RIGHT SIDE


NEAR THE OIL GAUGE STEM

AHI Valve 21534115

SERIAL NUMBER UNDER STICKER

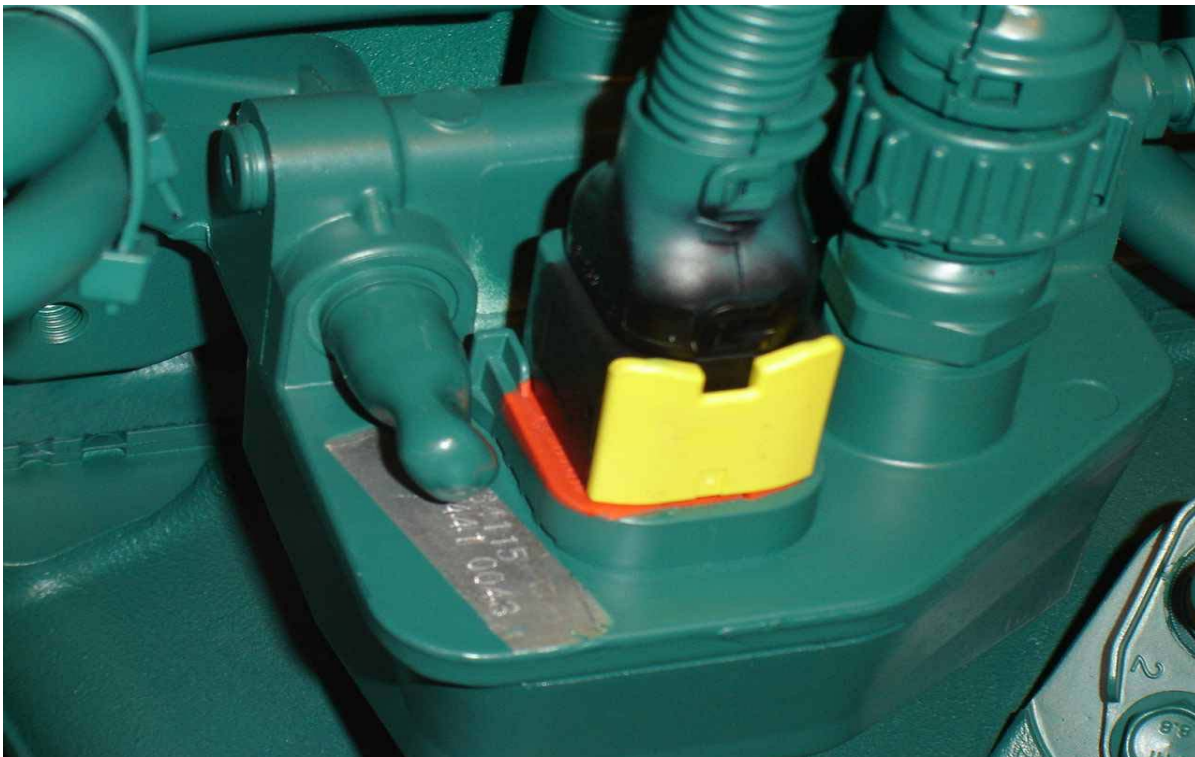

AHI modules with a clean Air Purge Valve (APV) are marked with Orange and Pink dots at the electrical connector.

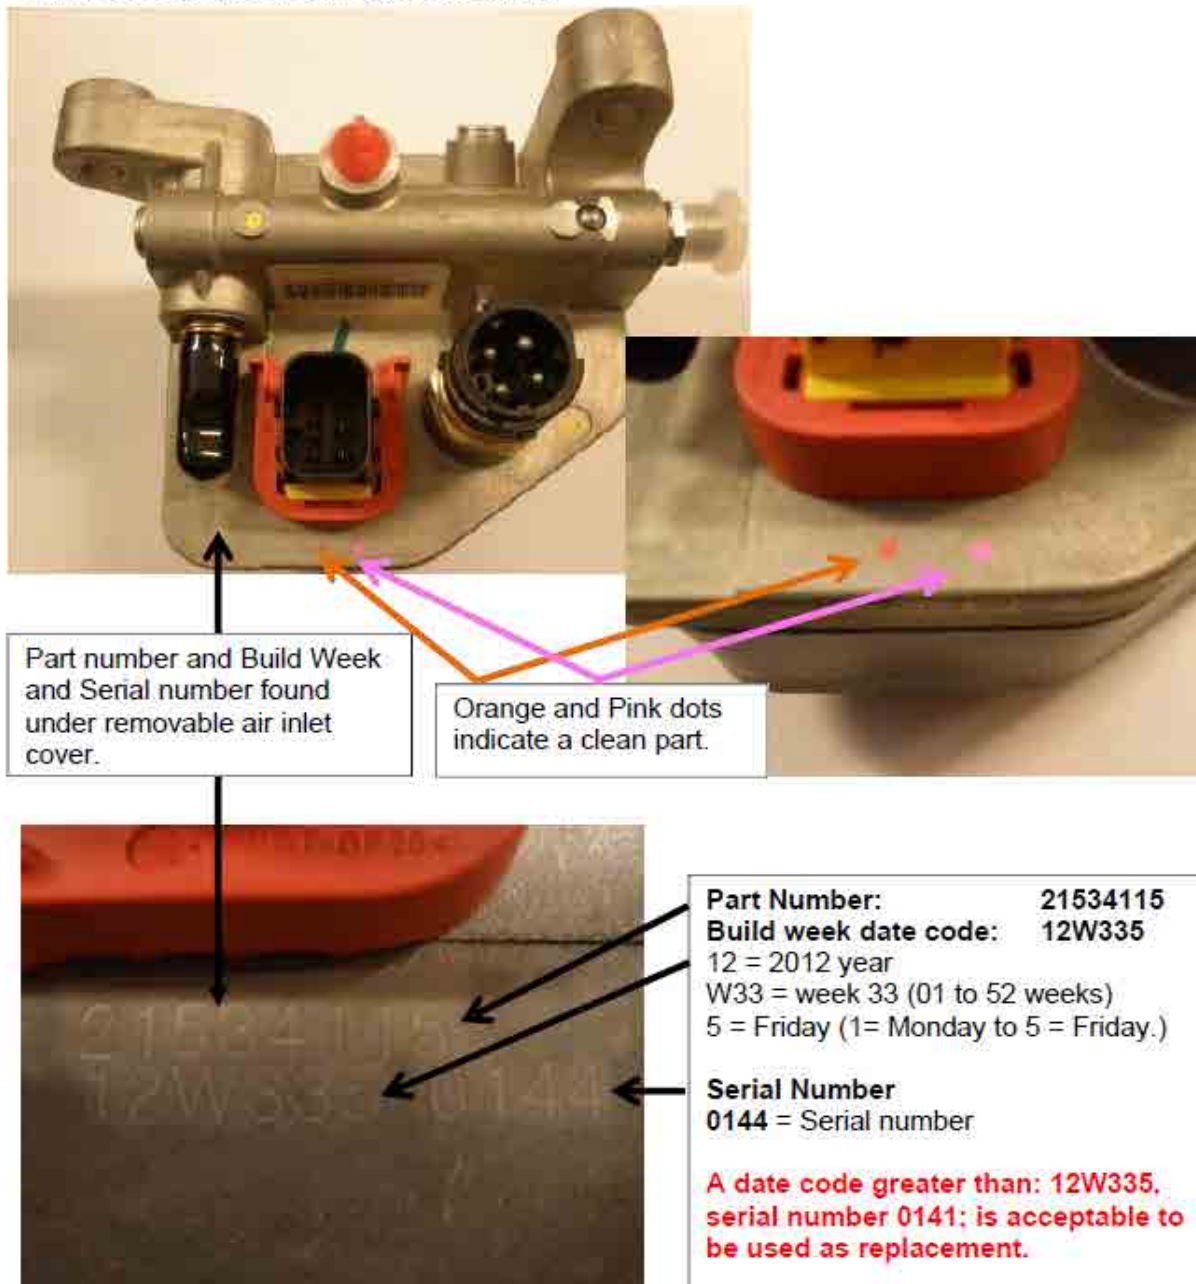

This document will be updated as additional information is obtained.