

## **SP13-23** BI-METAL CONTACT AT SIDE REFLECTOR (R13031)

THERE IS A RISK OF BI-METAL CONTACT (STAINLESS STEEL & ALUMINUM) LEADING TO CORROSION WHERE SIDE REFLECTOR IS INSTALLED ON THE EVAPORATOR DOOR.

VEHICLES WITH THE NEW ALUMINUM DOOR ARE INVOLVED

ON X3-45 COACHES


REMOVE THE SIDE REFLECTOR LOCATED ON THE EVAPORATOR DOOR

ENLARGE THE FIXING HOLES TO A DIAMETER OF 5/16" (8mm)

REINSTALL REFLECTOR USING :



**NUT WELL #500678 QTY 2**

**SCREW #5001305 QTY 2**

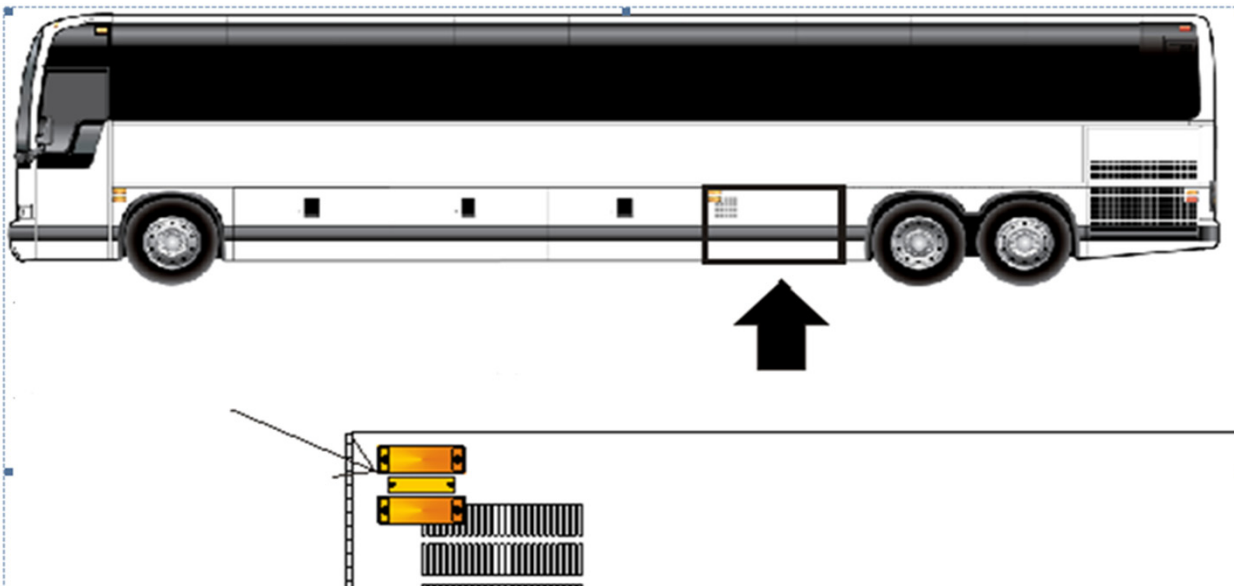

.....

.....

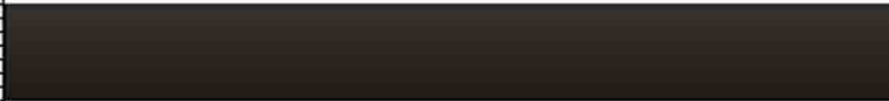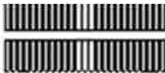

.....