

SP13-24
POSSIBLE AIR LEAK BETWEEN PROBE AND ADAPTOR ON AIR DRYER.
REFER TO SAP FOR NOTIFIED VEHICLES AND CODES
POUR LA VERSION FRANCAISE SE REFERER R13033.

ADDITION OF A RING IS REQUIRED TO PREVENT EXCESSIVE SQUEEZING OF THE O-RING
AND KEEP IT IN PLACE.

LIFT VEHICLE
RELEASE AIR PRESSURE IN SYSTEM
REMOVE PROBE FROM ADAPTOR ON AIR DRYER.

ADD RING QTY:1 AND RE-ASSEMBLE (TAKE RING FROM 641294 FITTING)
DISCARD FITTING OR RE-USE ACCORDING TO LOCAL RULES & REGULATIONS.

START VEHICLE
WAIT FOR PRESSURE TO STABILIZE.
CHECK AIR TIGHTNESS.



TIGHTENING THE
PROBE ON THE FITTING
WIDENS THE O-RING



TAKE FROM 641294.
THIS IS THE ONE RING





ADD RING TO SUPPORT O-RING AND LIMIT SQUEEZING