

Service Category	Audio/Visual/Telematics			Toyota Supports
Section	Navigation/Multi Info Display	Market	USA	ASE Certification

Applicability

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2012 – 2013	RAV4 EV	

REVISION NOTICE

September 6, 2013 Rev1:

• The Required Tools and Equipment, and Repair Procedure sections have been updated.

Any previous printed versions of this bulletin should be discarded.

Introduction

Some 2012 – 2013 model year RAV4 EV vehicles may experience a condition where the charge schedule function is intermittently inoperative. The condition may result from power interruption including: momentary blackout from the utility company, long term power outage, removing and reconnecting the charging plug, or other circumstances.

Follow the procedure in this bulletin to update the multi-information display software to address this condition.

NOTE

This software update does NOT affect:

- Vehicle charge start time
- The use of an EVSE timer
- Inability to charge on the 31st of the month

Production Change Information

This bulletin applies to vehicles produced **BEFORE** the Production Change Effective VIN shown below.

MODEL	PLANT	PRODUCTION CHANGE EFFECTIVE VIN
RAV4 EV	TMMC	2T3YL4DV#DW001893

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
EL1309	Firmware Update	0.3	86100-0R032	99	99

APPLICABLE WARRANTY

- This repair is covered under the Toyota Basic Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.
- Warranty application is limited to occurrence of the specified condition described in this bulletin.

Required Tools & Equipment

SPECIAL SERVICE TOOLS (SST)	PART NUMBER	QTY
USB Drive Firmware Update - DENSO*	01008-DENSO-13C	1

* Essential SST.

NOTE

- Additional SSTs may be ordered by calling 1-800-933-8335.
- Please discard the previous stick 01008-DENSO-13B.

Repair Procedure

- 1. Cycle the ignition to the "IG-ON" mode.
- 2. Plug the USB Drive SST into the USB slot located in the center console.
- 3. Press the Home button on the navigation screen. Figure 1.



Repair Procedure (Continued)

4. Press the Setup button ("wheel" mark on the bottom right of the screen).





Figure 3.



Figure 4.

General Settings	Ð	۶
Clock		1
Language	English	
Units	English	
Веер	On	
Keyboard Layout	QWERTY	Ŧ
	Sav	e

5. Press General.

6. Scroll to the second page.

Repair Procedure (Continued)

7. Press Software Update.

Figure 5.



8. Confirm the New software version is "VB503150." Then press *Update Software*.

Figure 6.

Software Update		-
Model ID : 1	ITSANNA-A	Z03
Cherry Contraction	Current	New
Navigation :	VB503102	VB503150
Bluetooth :	21.210	21.210
Map Update Software :	-	-
Update	Software	

Rev1

Charge Schedule Function Inoperative Intermittently

Repair Procedure (Continued)

9. Press Yes. The software update will take about 10 minutes.





Figure 8.



10. The screen in Figure 9 will display when the download is complete.

Figure 9.



Repair Procedure (Continued)

11. Remove the USB Drive SST and place the vehicle Figure 10. in "IG-OFF" mode. Then place the vehicle in "IG-ON" mode to restart the system. The update will automatically commence once the system has restarted.



Figure 11.



12. Press Do Not Display This Message Again.

Figure 12.



Repair Procedure (Continued)

13. Go back to the Software Update screen (follow steps 2 - 7).

Rev1

14. Confirm the Current software version is now "VB503150."

Figure 13.

Model ID : 1	11TSANNA-AZ	03
	Current	New
Navigation :	VB503150	-
Bluetooth :	21.210	-
Map Update Software :	-	-