S-SB-0011-13

## March 5, 2013



# Repair Manual Supplement: SRS DTCs Not Listed in Repair Manual

Service

Category Vehicle Interior

Section Supplemental Restraint Systems Man

Market USA



## **Applicability**

YEAR(S)	MODEL(S)	ADDITIONAL INFORMATION
2012	tC, xB	

#### Introduction

Some 2012 model year Scion tC and xB vehicles may set SRS Diagnostic Trouble Codes (DTCs) that are not listed in the Repair Manual. Refer to the chart in this bulletin to diagnose these DTCs.

#### **Warranty Information**

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
N/A	Not Applicable to Warranty	_	_	-	-

#### **Required Tools & Equipment**

REQUIRED EQUIPMENT	SUPPLIER	PART NUMBER	QTY	
Techstream 2.0*		TS2UNIT		
TIS Techstream	ADE	TSPKG1	1	
Techstream Lite		TSLITEDLR01		

<sup>\*</sup> Essential SST.

#### **NOTE**

- Only ONE of the Techstream units listed above is required.
- Software version 8.00.034 or later is required.
- Additional Techstream units may be ordered by calling Approved Dealer Equipment (ADE) at 1-800-368-6787.

# Repair Manual Supplement: SRS DTCs Not Listed in Repair Manual

## **SRS DTC Cross Reference List**

If an SRS DTC set is not listed in the Repair Manual, refer to the chart below. Follow the diagnostic procedures listed in the Repair Manual for the corresponding Repair Manual DTC.

MODEL	SET DTC	DETECTION ITEM	REPAIR MANUAL DTC
	B1603	Front Satellite Sensor Bus RH Initialization Incomplete	<u>B1610</u>
tC	B1608	Front Satellite Sensor Bus LH Initialization Incomplete	<u>B1615</u>
	B1643	Side Satellite Sensor Bus RH Initialization Incomplete	<u>B1630</u>
	B1648	Side Satellite Sensor Bus LH Initialization Incomplete	<u>B1635</u>
	B1603	Front Satellite Sensor Bus RH Initialization Incomplete	<u>B1610</u>
хВ	B1608	Front Satellite Sensor Bus LH Initialization Incomplete	<u>B1615</u>
	B1643	Side Satellite Sensor Bus RH Initialization Incomplete	B1630
	B1648	Side Satellite Sensor Bus LH Initialization Incomplete	<u>B1635</u>