

Manual release of 2nd seat row breaks (black/red handle)

Topic number	LI91.22-P-055640
Version	1
Design group	91.22 Seat bench, folding seat bench
Date	02-21-2013
Validity	Model series X166
Reason for change	
Reason for block	

Complaint:

When the 2nd seat row is folded, the black/red release handle can break, meaning that the rear bench seat can no longer be unlocked or folded down.

Cause:

Improper operation of the release handle can produce excessive stress on the material.

Remedy:

Replace release handle.

Remove release handle as described in AR91.12-P-0100GQ under operation steps 1-10.

Install release handle in reverse order.

IMPORTANT:

Additionally fasten the release handle to the seat structure using a cable tie (see attachment for position and location of cable tie)

Attachments	
File	Designation
Position Kabelbinder.pdf	Position of cable tie for fastening release handle

Symptoms
Body / Seat / Seat adjustment / Does not unlock

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 002 997 24 90			Cable tie	1	Fastening of release handle	X	
A 166 920 91 00			Release handle	1	Release handle	X	

Work units				
Op. no.	Operation text	Time	Damage code	Note
			92A1E 07	Left rear bench seat lock/handle cracked
			92N1E 07	Right rear bench seat lock/handle cracked

Validity		
Vehicle	Engine	Transmission
GL (166)	*	*