

Impairment of electrical folding function of 2nd seat row (SA code 843)

Topic number	LI91.12-P-055797
Version	1
Design group	91.12 Rear seats
Date	03-26-2013
Validity	Model series X166 with SA code 843 (2nd seat row, electrically folding)
Reason for change	
Reason for block	

Complaint:

The electrical folding function of the 2nd seat row can malfunction partially or completely (SA code 843).

Cause:

The cable (Bowden cable) of the electrical folding function can detach from the counterholder.

Remedy:

Installation of felt tape on the vinyl ring of the cable, as shown in the picture in the attachment.

Risk of injury: For all work, observe AS00.00-Z-0009-01A!

1. Remove exterior lining, steps 1-10, as described in AR91.12-P-0100GQ
2. Wrap vinyl ring with felt tape and then press into counterholder of seat structure and fix in place. See Figure 1!

Trim felt tape as required.

3. Install outer lining in the reverse order.

Move rear seat to default position and check the effectiveness of the repair!

Attachments	
File	Designation
Pic1.jpg	Remedial action, location of felt
Pic2.jpg	Overview of routing of cable (Bowden cable)

Symptoms
Body / Seat / Seat adjustment / Function error

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A 001 983 23 10			Felt	1	Order felt as required	X	

Work units


Op. no.	Operation text	Time	Damage code	Note
			92A29 D6	Vinyl ring of cable detached from counterholder
			92N29 D6	Vinyl ring of cable detached from counterholder

Validity

Vehicle	Engine	Transmission
GL (166)	*	*

Attachments

Pic1.jpg:

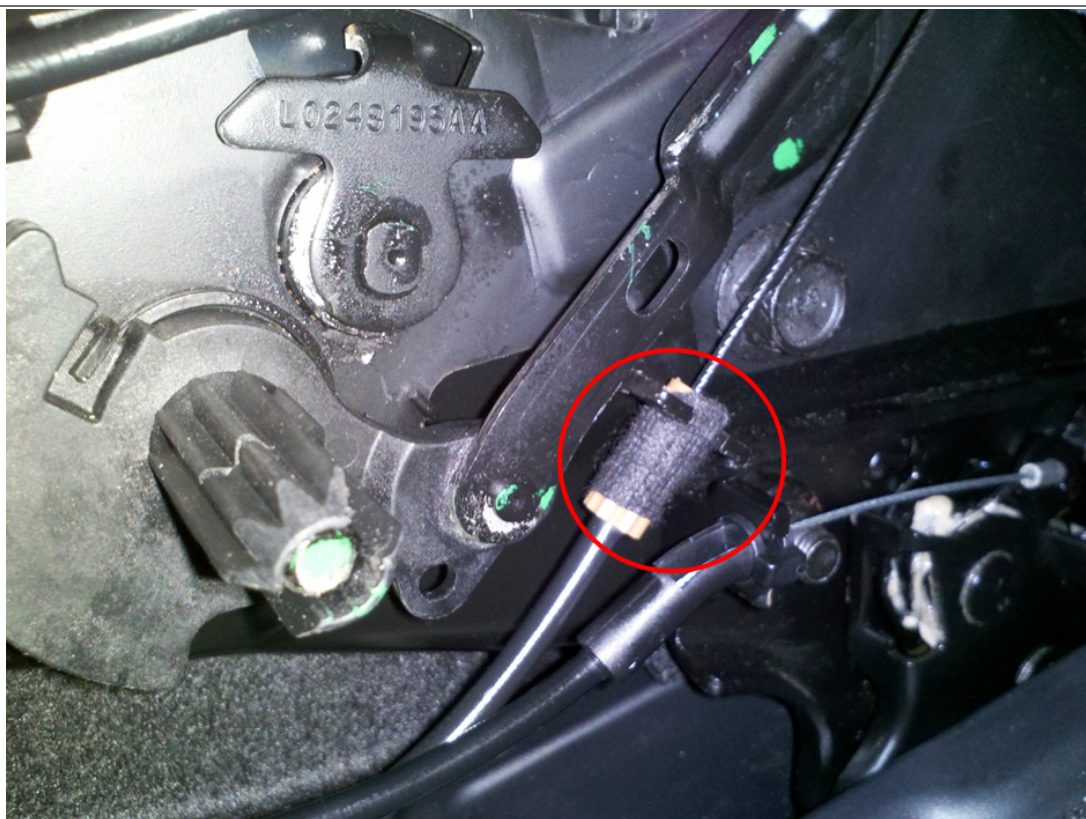

Pic2.jpg:

