



Countries: CANADA, UNITED STATES
Availability: ISIS, Body Builder
Major System: ELECTRICAL SYSTEM
Current Language: English
Other Languages: [Français](#), [Español](#),
Viewed: 2256
Document ID: IK0800323
Revision: 2
Created: 11/23/2011
Last Modified: 1/21/2013
Author: Will (Mark) Wiley

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 331	Not Helpful 122
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	----------------------------------	--------------------------------------

Title: 2007 to 2009 MaxxForce 7 Active 1213 code after running DOC Cleaning Procedure

Applies To: MaxxForce 7

DESCRIPTION

After Running the DOC Cleaning Procedure, fault code1213 Remote Throttle Signal Out-of-Range becomes active.

POSSIBLE DIAGNOSTIC TROUBLE CODES

DTC	MODULE	DESCRIPTION
1213	ECM	Remote Throttle Signal Out-of-Range

RESOLUTION

Connect with Service Maxx, If you do not have a remote throttle set ECM parameter 75001 to 2 In Cab Operation only.
 If you do have a remote throttle set ECM parameter 75041 to 0 disable.

Hide Details

Feedback Information

Viewed: 2255 Helpful: 331 Not Helpful: 122
No Feedback Found