



SI B34 05 13
Brakes

April 2013
Technical Service

SUBJECT

Hill Descent Control Inoperative After Programming with ISTA/P 2.49.0 or 2.49.1

MODEL

F01

F02

F07

All models with xDrive produced from 09/2008 to 03/2012

F10

F12

F13

All models with xDrive produced from 09/2008 to 07/2011

SITUATION

Hill Descent Control is inoperative after programming the vehicle with ISTA/P versions 2.49.0. or 2.49.1.

CAUSE

Central Gateway Module software error

CORRECTION

Run diagnostics with ISTA/D. Work through the corresponding test module and then program and code the vehicle with ISTA/P 2.49.2 or a more recent version.

Do not replace any parts.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty or the BMW Certified Pre-Owned Program.

Defect Code:	61 35 90 15 00	
Labor Operation:	Labor Allowance:	Description:
00 61 038	10 FRUs	Programming/encoding control units (Main work) (Includes a vehicle test and charging the battery)
or		

00 61 609	8 FRUs	Programming/encoding control units (Plus work – Vehicle is already in the workshop) (Includes a vehicle test and charging the battery)
-----------	--------	---

Labor operation code 00 61 038 is a Main labor operation. If you are using a Main labor code for another repair, use the Plus code labor operation 00 61 609 instead.

If a control module was working properly and/or had no related faults stored prior to vehicle programming and it fails to program correctly or requires initialization, this additional work must be claimed with separate labor operations under the defect code listed above; refer to KSD2.

Other Repairs

If performing other ISTA diagnostics and related test plans results with **eligible and covered work**, claim this work with the applicable defect code and labor operations listed in KSD2.

[Copyright ©2013 BMW of North America, Inc.]