



SI B61 19 12  
General Electrical Systems

February 2013  
Technical Service

This Service Information bulletin supersedes SI B61 19 12 **dated June 2012**.

**NEW** designates changes to this revision

#### SUBJECT

**ActiveE: Charging Contact Protective Sleeve**

#### MODEL

E82E (1 Series ActiveE)

#### SITUATION

During the performance of the scheduled 3 months/5,000 miles service (Vehicle Check), it may be determined that some of the contact protective sleeves in the charging socket are missing (see page 13 of attachment #4 from SI B00 08 11).

#### Note:

Missing contact sleeves would not cause any KLE charging failures, nor set any charging-related faults in the EME.

#### **NEW** CORRECTION

Submit a PuMA case titled: "E82E: Charging Socket Contact Sleeve."

To replace the missing sleeves, follow the attached repair procedure.

#### **NEW** PARTS INFORMATION

Part Number	Description	Quantity
12 52 7 649 428	Contact sleeve (large)	2
12 52 7 649 429	Contact sleeve (small)	1

#### WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty.

**Defect Code:** 85 99 01 47 EE

Labor Operation:	Labor Allowance:	Description:
61 99 000	3 FRU	Work time to install the charging socket pin's protective sleeves (up to 3 sleeves) as necessary, with performing the Vehicle Check (Plus work)

Even though work time labor operation code 61 99 000 ends in "000," it is not considered a Main labor operation.

#### ATTACHMENTS

view PDF attachment [B611912 Attachment](#).

[ Copyright © 2013 BMW of North America, LLC ]