



SI B34 07 13
Brakes

July 2013
Technical Service

SUBJECT

Brake Fluid Maintenance Service: 36-Month Interval

MODEL

E82

E88

E89

E90

E91

E92

E93

Produced from 03/2011 to 03/2012

E70

E71

Produced from 04/2011 to 03/2012

F25

Produced from 10/2011 to 03/2012

F30

Produced from 11/2011 to 03/2012

SITUATION

The coding in these vehicles has the CBS displaying the first brake fluid service as a 36-month interval from the date of production, instead of the appropriate 24-month interval.

CORRECTION

There is no software solution for this issue.

If an affected vehicle is at your center, the first brake fluid service and the “connected” microfilter service” can be performed as:

- **Recommended**

Starting at “112 days” prior to 24 months from the date of production (day 618 and higher);

or

- **Due**

At or after 24 months from the date of production (day 730 and higher).

Once this first brake fluid service is performed and the CBS data is reset, this service interval reverts to every 24 months from the date of the last CBS reset.

Note: Applicable BMW vehicles produced as of July 2013 are excluded from the correction procedure noted in this Service Information bulletin.

WARRANTY INFORMATION

Covered under the terms of the BMW Maintenance Program.

| | | |
|-------------------------|-------------------------|---------------------|
| Defect Code: | 34 00 00 77 MP | |
| | | |
| Labor Operation: | Labor Allowance: | Description: |
| 00 00 618 | Refer to KSD2 | Brake Fluid Service |

Labor operation code 00 00 618 is an associated labor operation to the Standard Scope labor operation 00 00 105.

[Copyright ©2013 BMW of North America, Inc.]