



SI B36 03 13
Wheels and Tires

November 2013
Technical Service

PERFORM THE PROCEDURE OUTLINED IN THIS SERVICE INFORMATION ON ALL AFFECTED VEHICLES BEFORE CUSTOMER DELIVERY OR THE NEXT TIME THEY ARE IN THE SHOP FOR MAINTENANCE OR REPAIRS.

SUBJECT

Service Action: Continental Tires, Inspect and Replace if Necessary

MODEL

F30

F31

F32

SITUATION

During manufacturing process of the Continental tires, there may have been a deviation from the production specifications.

AFFECTED VEHICLES

This Service Action involves F30, F31 and F32 vehicles.

In order to determine whether a specific vehicle has had this Service Action completed or is affected by this Service Action, first check the B-pillar label for code number **659**. If code number **659** has been punched out, the campaign has already been performed. If code number **659** has not been punched out, it will be necessary to utilize the "Service Menu" of DCSnet (Dealer Communication System) or the Key Reader. Based on the response of the system, either proceed with the corrective action or take no further action.

CORRECTION

Check for the affected mold number:



Only tires with mold number **218493** are affected.

If the identification mark **218493** is present, continue with the **DOT number check**.

Tires with identification marks from other molds are not affected. No other measures are necessary in this case.

DOT Number



Check:

Only the tires with DOT numbers **3913, 4013 or 4113** are affected.

Tires with other DOT numbers, such as 4213 (shown here), are not affected.


Replace the affected tires.

IMPORTANT: Replaced tires should be damaged beyond repair to ensure they are not reused.

PARTS INFORMATION

Part Number	Description	Quantity
36 11 2 334 878	Conti Pro Contact SSR 225/45R18 91V	Max. 4
36 11 6 766 ***	Balance weights (refer to ETK)	As required

LABEL INSTRUCTIONS

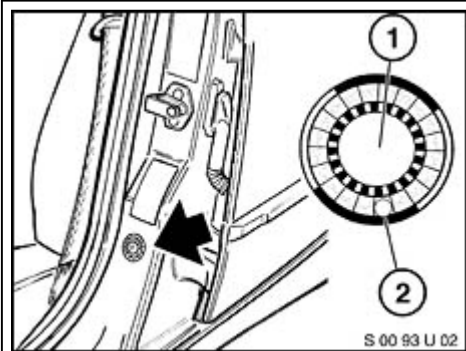

This Service Action has been assigned code number **659**. After the vehicle has been checked and/or corrected, obtain a label (SD 92-420) and:

- A. Emboss your BMW center warranty number in the middle of the label (1);
- B. Punch out code number **659** (2), printed on the label; and
- C. Affix the label to the B-pillar as shown.

If the vehicle already has a label from a previous Campaign, affix the new label next to the old one. Do not affix one label on top of another one because a number from an underlying label could appear in the punched-out hole of the new label.

WARRANTY INFORMATION

Reimbursement for this Service Action will be via normal claim entry utilizing the following information:

Special Defect Code:	00 36 82 01 00	
Labor Operation:	Labor Allowance:	Description:
00 61 895	3 FRUs	Check all 4 tires, no repair necessary
or		
00 61 896	10 FRUs	Check all tires, replace and balance 1 tire
or		
00 61 897	16 FRUs	Check all tires, replace and balance 2 tires
or		
00 61 898	23 FRUs	Check all tires, replace and balance 3 tires
or		
00 61 899	30 FRUs	Check all tires, replace and balance 4 tires

The labor operation codes are all Plus labor operations.

[Copyright ©2013 BMW of North America, Inc.]