



This Service Information bulletin supersedes SI B51 55 10 **dated December 2010**.

NEW designates changes to this revision

SUBJECT

Rear Window Release Button Leaks Water

MODEL

E91

E61

NEW Produced to March 2011

SITUATION

Various complaints may include:

- The rear window button is not working
- The tailgate opens when the vehicle is driven, or
- The rear window opens when starting.

CAUSE

Water intrusion into the rear window release button micro-switch

NEW PROCEDURE

Replace the rear window push button switch with the improved sealing.

NEW PARTS INFORMATION

Part Number	Description	Quantity
61 31 9 200 673	Rear window switch	1

NEW WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty.

Defect Code:	61 30 33 14 00	
Labor Operation:	Labor Allowance:	Description:
61 31 245	Refer to KSD2	Removing and installing or removing rear window push button

Labor operation code 61 31 245 is a Main labor operation. If you are using a Main labor code for

another repair, use the Plus code labor operation 61 31 748.

Refer to KSD2 for the corresponding flat rate unit (FRU) allowance. Enter the Chassis Number, which consists of the last 7 digits of the Vehicle Identification Number (VIN). Click on the “Search” button, and then enter the applicable flat rate labor operation in the FR code field.

[Copyright ©2013 BMW of North America, Inc.]