



SI B63 07 13
Lights

November 2013
Technical Service

SUBJECT

Daytime Running Light Does Not Switch ON

MODEL

F01

F02

F04

F06

F07

F10

F12

F13

F15

F25

F30

F31

F32

F34

Produced from June 30, 2013 to February 27, 2014

With an option code 609 (Navigation System)

SITUATION

The DRL (Daytime Running Light) is off and cannot be switched on after importing the personal profile from another vehicle. The CID (Central Information Display) display shows that it is active.

CAUSE

Software error when importing the personal profile from a vehicle which has a different head unit

PROCEDURE

DO NOT replace parts or program the vehicle.

Only if the personal profile was imported for another vehicle, follow the procedure below to reset the personal profile:

1. From the CID main screen, select “Setting.”
2. Select “Profile” menu.
3. Click on the current profile.
4. Click on the “Option” button on the center console.
5. Select “Reset current profile.”
6. Repeat the reset for all profiles.

Please advise the customer not to import his or her personal profile from another vehicle.

WARRANTY INFORMATION

Covered under the terms of the BMW New Vehicle/SAV Limited Warranty.

Defect Code:	65 12 58 02 00	
Labor Operation	Labor Allowance	Description
63 99 000	3 FRUs	Work time to reset profile (Main work)
or		
63 99 000	1 FRU	Work time to reset profile (Plus work – vehicle is already in the workshop)

[Copyright ©2013 BMW of North America, Inc.]