



SI B13 04 13
Fuel System

October 2013
Technical Service

This Service Information bulletin supersedes SI B13 04 13 **dated September 2013.**

NEW designates changes to this revision

SUBJECT

N55 Engine: Erroneous Service Engine Soon Lamp Illuminated with Mixture Faults Stored in the DME

MODEL

F01

F02

F06

F07

F10

F12

F13

F25

F30

F31

F32

E84

INFORMATION

An error has been identified in the current version of ETK regarding N55 fuel injector replacement part numbers and production dates. Installing the incorrect injector part number can lead to an erroneous Service Engine Soon lamp illumination and various mixture faults stored in the DME.

Correct part numbers and applicable production dates:

NEW P/N 13 64 7 639 994 is for all vehicles produced from 7/2013

NEW P/N 13 64 7 597 870 is for all vehicles produced from 1/2011 to 7/2013

NEW P/N 13 53 7 568 607 is for all vehicles produced to 1/2011

NEW It is good practice to verify that the part number being removed from the engine matches the new injector part number, until further notice. When the ETK data is corrected, a notification will be distributed.

WARRANTY INFORMATION

Not applicable.

[Copyright ©2013 BMW of North America, Inc.]