



SI M33 01 12
Rear Axle

October 2013
Technical Service

This Service Information bulletin supersedes SI M33 01 12 dated **December 2012**.

NEW designates changes to this revision

SUBJECT

Adjusting Rear Camber

MODEL

NEW R55

NEW R56

NEW R57

NEW R58

NEW R59

R60

NEW R61

SITUATION


Rear camber cannot be adjusted properly.

CAUSE

Repair instructions not followed properly

PROCEDURE

Follow these steps when adjusting the rear camber:

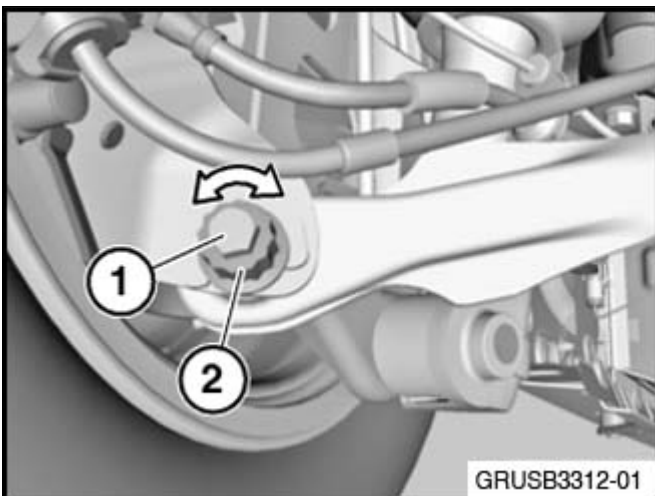

- Raise the rear axle (tire spin-free).
- Loosen the lock bolt (1).
- Turn the eccentric adjuster (2) to full positive (large portion of eccentric points down).
- Slightly tighten the lock bolt (1).
- Lower the axle and compress suspension.
- Slacken the lock bolt (1) and adjust the camber (2).

- | | |
|--|---|
| | <ul style="list-style-type: none">• Tighten down the lock bolt. |
|--|---|

This procedure can be found in Repair Instruction 32 00 620, “Adjusting rear axle.”

Failure to follow these steps may result in damage to the adjustment bore in the rear trailing arm.

WARRANTY INFORMATION

Not applicable.

[Copyright ©2013 BMW of North America, Inc.]