



SI B13 04 13
Fuel System

September 2013
Technical Service

SUBJECT

N55 Engine: Erroneous Service Engine Soon Lamp Illuminated with Mixture Faults Stored in the DME

MODEL

F01

F02

F06

F07

F10

F12

F13

F25

F30

F31

F32

E84

INFORMATION

An error has been identified in the current version of ETK regarding N55 fuel injector replacement part numbers and production dates. Installing the incorrect injector part number can lead to an erroneous Service Engine Soon lamp illumination and various mixture faults stored in the DME.

Correct part numbers and applicable production dates:

P/N 13 64 7 639 994 is for all vehicles produced from 7/2013

P/N 13 64 7 597 870 is for all vehicles produced up to 7/2013

WARRANTY INFORMATION

Not applicable.

[Copyright ©2013 BMW of North America, Inc.]