

Tech Tips

TT 57-12-03

Date: February 3, 2012

2012-2014 Beetle, Beetle Convertible, Eos, Golf/GTI, Jetta, Jetta Sportwagen, Tiguan – Remote Functions Inoperative and/or Faults 00955, 00956, 02660

September 13, 2013: Update to Applicability.

If the remote key fob is depressed repeatedly or a button is held down while outside the remote operating range, the key remote functions may no longer operate. Fault codes 00955 005 "Key 1 no or incorrect basic settings", 00956 005 "Key 2 no or incorrect basic settings", or 02660 "Radio Remote control operation not adapted" may be set in the Vehicle Electrical System Control Module -J519- if GFF is run.

<u>Before</u> running GFF or attempting any adaptation with the scan tool, attempt to restore remote functionality by following the key synchronization procedure below.

- Unfold the key bit on the vehicle key
- Remove the cap from the outside door handle on the driver door
- Standing immediately next to driver outside door handle, press the lock button on the vehicle key.
- Within one minute, manually unlock the vehicle using the key.
- Reinstall the cap.

This procedure can be found in the vehicle's Owner Manual for customer reference.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.