Das Auto.

Tech Tips

TT 57-12-03

Date: February 3, 2012

2011-2013 Passat, 2012 EOS, Jetta, Jetta SportWagen, Golf/GTI, Passat, Tiguan – Remote Loses Programming

October 18, 2013: Update to information.

Fault code 00955 005 or 00956 005 may be set in the Vehicle Electrical System Control Module -J519- if the remote key fob is depressed repeatedly, or a button is held down. Customer may complain the remote no longer operates.

To reset, remove the cover over the lock on the driver's door handle, cycle the key to lock, and then back to unlock. This should synchronize the remote and allow operation. Clear the fault and retest operation.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.





Page 2 of 2

© 2013 Volkswagen Group of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Volkswagen Group of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.