



Countries:	RUSSIA, AUSTRALIA, CANADA, UNITED STATES, MEXICO	Document ID:	IK1200838
Availability:	ISIS, FleetISIS	Revision:	1
Major System:	ENGINES	Created:	11/8/2012
Current Language:	English	Last Modified:	8/27/2013
Other Languages:	NONE	Author:	Jim Restemayer
Viewed:	453		

[Less Info](#)

Hide Details

Coding Information

Copy Link 	Copy Relative Link 	Bookmark View My Bookmarks	Add to Favorites 	Print 	Provide Feedback 	Helpful 15	Not Helpful 27
----------------------	-------------------------------	--	-----------------------------	------------------	-----------------------------	--------------------------	------------------------------

Title: 2010 Emissions Pre-DOC Mounting clamp

Applies To: 2010 Emissions 11L and 13L Engines

DESCRIPTION


PDOC Clamp breakage

REPAIR PROCEDURE

The mounting clamp for the Pre-DOC has been modified to be more robust and resist breakage. Units with failed mounting clamps should be upgraded to a new V-Band clamp which will need a new wide bracket to allow for the clamp to be secured. In the case that the unit has a new style V-Band clamp that fails and already has the upgraded wider bracket, simply replace the V-Band clamp.

SYMPTOMS

- PDOC clamp broken or missing

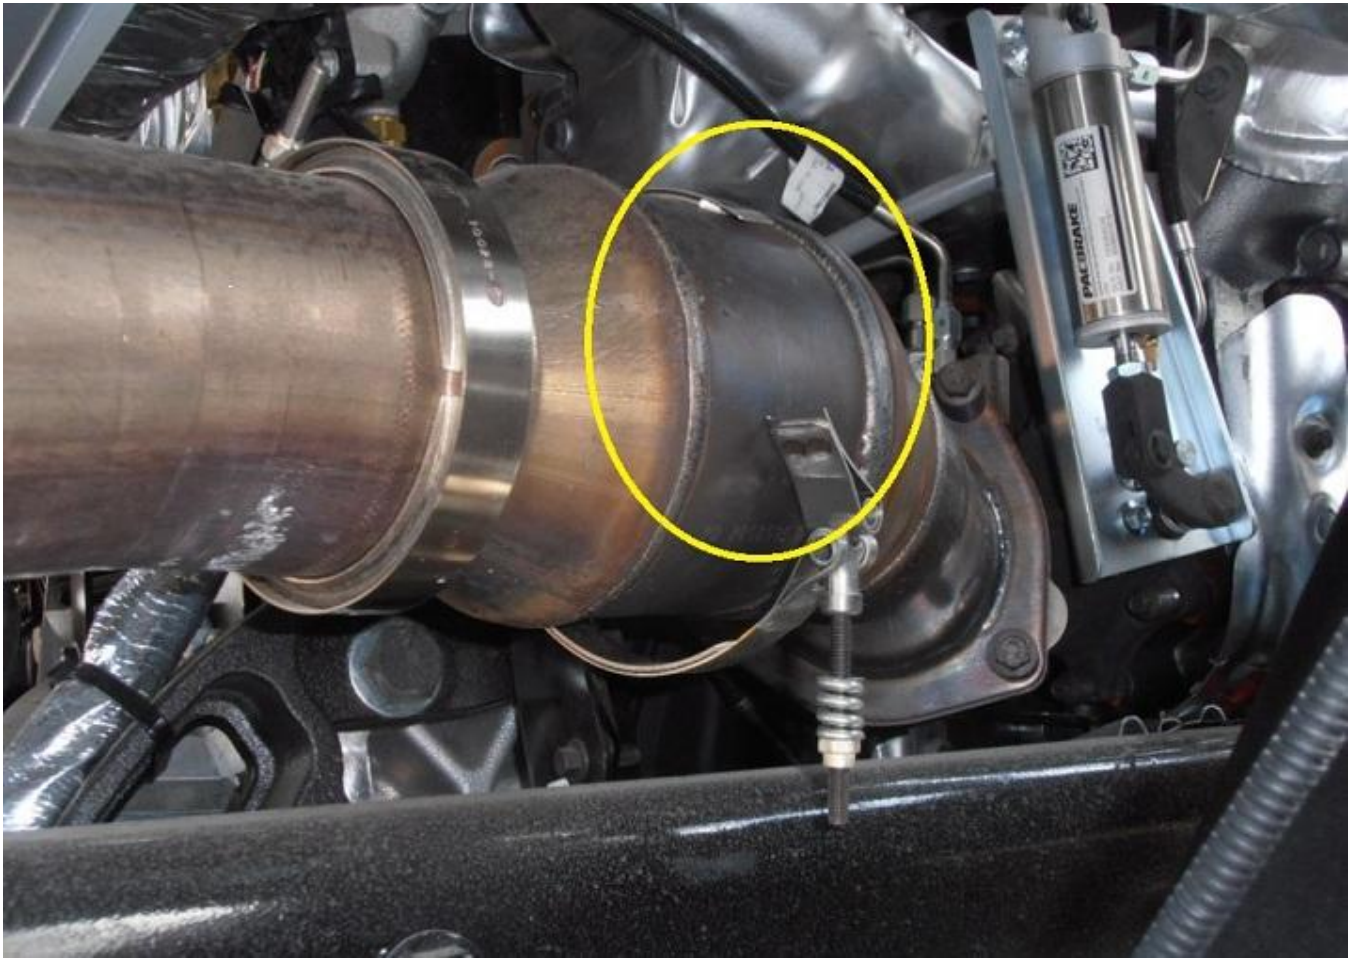

PARTS INFORMATION

Part #	Description	Qty.
3017638C1	Clamp, V-Band	1
3018262C1	Wide Bracket	1

TROUBLESHOOTING

1. Visual inspection of PDOC for broken or missing clamp

RESOLUTION

- When broken or missing clamp is discovered, install the V-Band type clamp listed in the Part Information Section
- New Style Clamp pictured



- **Install new clamp in place so that the V-Clamp bolt head is facing the 2 o'clock position when viewed from rear of truck**



- Torque Clamp to 3 Nm / 26-27 in. lbs.
- Torque PDOC clamp bracket bolts to standard torque



 Hide Details

Feedback Information

Viewed: 452
 Helpful: 15
 Not Helpful: 27

Staff ID	Client ID	Comments	Created Date
	DYYGXBN	You received the following feedback From: dyygxbn - Gary Bowler Email Address: bowlerg@rushenterprises.com Job Classification: SE008, Service Technician Dealer: RUSH TRUCK CENTERS OF UT Feedback: The straight clamp is breaking but we are replacing the V-clamp? What is the part number for the straight clamp?	8/28/2013 9:25:29 AM

Copyright © 2013 Navistar, Inc.