

Flapping/ rattling noise in area of center tunnel

Topic number	LI83.00-P-055425
Version	2
Design group	83.00 General
Date	07-01-2013
Validity	Model series W/X166 with code 580
Reason for change	Remedy adapted
Reason for block	

Complaint:

A flapping/rattling noise can be heard from the area of the center console towards the rear.

Cause:

Due to the designed arrangement of the air distribution flap under the center console, a flapping/rattling noise may occur. This symptom can arise depending on the setting of the air conditioning (e.g. high blower speed).

Remedy:

Attach damping strip (A 000 987 4066) to air distribution flap (see attachment).

Replacing the air distribution flap does not remedy the problem..

Attachments	
File	Designation
Help Booster Flap 166 Gl.pdf	Help/assistance

Symptoms
Body / Air conditioning / Air conditioning / Noise

Parts							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other make part
A0009874066			Damping strip	1			X

WIS-References			
Document number	Title	Note	Allocation
AR68.20-P-2000GQ	Remove/install center console		Remedy

Validity		
Vehicle	Engine	Transmission
166.003	*	*
166.004	*	*
166.023	*	*
166.024	*	*
166.055	*	*
166.057	*	*
166.058	*	*
166.073	*	*
166.074	*	*
166.823	*	*
166.824	*	*
166.872	*	*
166.873	*	*
166.874	*	*