



Mercedes-Benz
The best or nothing.

star bulletin



Date: July 23, 2013
Order No.: S-B-67.00/29
Group: 67

**SUBJECT: MY-All, Model 166, 242 with Code 882 Interior Monitoring (Infrared)
Omission of Glass Breakage Loops on Side Windows and Rear Window**

Since 12/2012 (model 166) and since 06/2013 (model 242) the glass breakage loops are no longer in the side windows and rear window. Suitable interior protection ensures that the interior monitoring function continues to operate correctly.

Only side windows and rear windows without glass breakage loops are now available from parts. On vehicles produced before aforementioned production dates, perform the following when the side windows or rear window are replaced.

Procedure

1. Install new side windows or rear window without glass breakage sensor.
2. Tie back electrical line from glass breakage sensor.
3. Perform SCN coding on ATA/towaway protection/interior protection control unit (N26/6).
Note that Xentry DAS version 03/2013 or a more current version must be installed. Select "Control units view – ATA interior protection – Adaptations – Configuration – SCN coding."

This bulletin has been created and maintained in accordance with MBUSA-SLP S423QH001, Document and Data Control, and MBUSA-SLP S424HH001, Control of Quality Records.