



Countries: AUSTRALIA, BRAZIL, CANADA, UNITED STATES, SOUTH AFRICA
Availability: ISIS, FleetISIS, Body Builder
Major System: ENGINES
Current Language: English
Other Languages: [Français](#), [Español](#),
Viewed: 1883

Document ID: IK1200416
Revision: 3
Created: 10/27/2009
Last Modified: 3/14/2013
Author:

[Less Info](#)

Hide Details

Coding Information

Copy Link	Copy Relative Link	Bookmark	Add to Favorites	Print	Provide Feedback	Helpful	Not Helpful
		 View My Bookmarks				 298	 584

Title: Dual Throttle Pedal Harness Troubleshooting

Applies To: 7000 4000 Models with Dual Throttle Harness and Switch Installed.

DESCRIPTION

Dual throttle pedals are inoperative.

SYMPTOMS

- Will not accelerate
- Check engine light on

POSSIBLE DIAGNOSTIC TROUBLE CODES

DTC	MODULE	DESCRIPTION
134	Engine	APS/IVS conflict

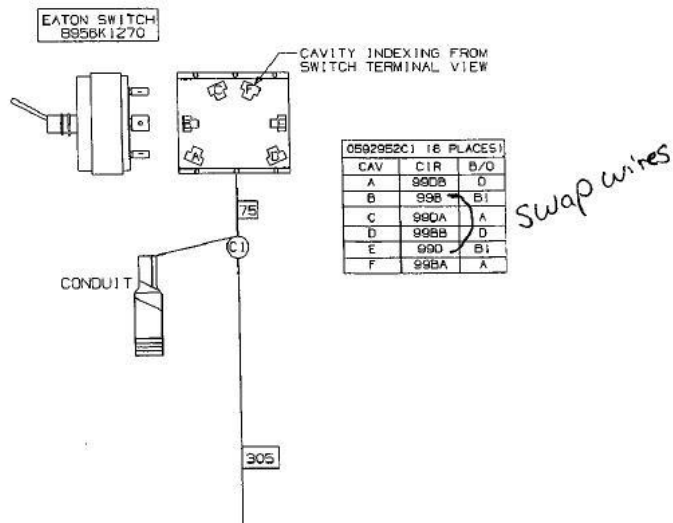
TROUBLESHOOTING

1. Remove dash panel and inspect wiring on switch.
2. Refer to [TSI 10-08-01](#). With a dual pedal set up, the **NEW STYLE SENSOR** listed in the **TSI WILL NOT WORK**.

SERVICE PROCEDURE

1. Check the wires on the back of the selector switch
2. Verify that wire 99B is in cavity B
3. Verify that wire 99D is in cavity E
4. If these are incorrect please swap the two wires.
5. If these wires are in the correct locations please follow the correct Iknow article for the aps troubleshooting.

CIRCUIT DIAGRAM

[Hide Details](#)

Feedback Information

Viewed: 1882

Helpful: 298

Not Helpful: 584

No Feedback Found