## **Technical Bulletin**



# SERVICE BULLETIN

Classification: Reference: Date:

EL12-085a NTB13-023a April 2, 2013

# 2013 ALTIMA AND PATHFINDER; IGNITION BUTTON WILL NOT RESPOND DURING REMOTE START USE

This bulletin has been amended to change the Claims Information.

No other changes have been made to the bulletin.

**APPLIED VEHICLE** 2013 Altima (L33)

VIN AND DATE: Built before 1N4AL3AP(\*)DC 150330, Oct 01, 2012

Built before 1N4BL3AP(\*)DN 454258, Oct 01, 2012

2013 Pathfinder (R52)

Built before 5N1AR2MM(\*)DC 602921, Oct 01, 2012

#### IF YOUR CONFIRM:

During or after a "Remote Engine Start" (RES) operation:

The ignition switch will not respond to any input.

#### And

- ELEC IGN relay and IPDM IGN relay may turn ON and OFF continuously, while ACC remains OFF.
- Brake and charge lamps may blink continuously.
- DTCs P2103 and U1000 may be present.

#### **ACTION:**

 Replace Body Control Module (BCM) with Part listed on the next page in PARTS INFORMATION.

**IMPORTANT:** BEFORE removing the BCM refer in the appropriate ESM to **M: ELECTRICAL & POWER CONTROL**, **BCS – Body Control System, BCM BASIC INSPECTION** to begin the procedure for BCM Replacement.

Nissan Bulletins are intended for use by qualified technicians, not 'do-it-yourselfers'. Qualified technicians are properly trained individuals who have the equipment, tools, safety instruction, and know-how to do a job properly and safely. NOTE: If you believe that a described condition may apply to a particular vehicle, DO NOT assume that it does. See your Nissan dealer to determine if this applies to your vehicle.

### **PARTS INFORMATION**

DESCRIPTION	PART #	QUANTITY
BCM for Altima (L33)	284B2-3TA0C	1
BCM for Pathfinder (R52)	284B1-3JA1D	1

# <u>Altima</u>

### **CLAIMS INFORMATION**

Submit a Primary Part (PFP) type line claim using the following claims coding:

OPERATION	OP CODE	PFP	SYM	DIAG	FRT
REPLACE BCM	RX3AAA	284B2-3TA0C	ZE	32	1.1

# **Pathfinder**

## **CLAIMS INFORMATION**

Submit a Primary Part (PFP) type line claim using the following claims coding:

OPERATION	OP CODE	PFP	SYM	DIAG	FRT
REPLACE BCM	RX3AAA	284B1-3JA1D	ZE	32	1.0

2/2 NTB13-023a