

Reference	SSM52757
Models	Range Rover Sport / L320 LR3 / L319 LR4 / L319
Title	Brake Switch Adjustment and Setting Procedure
Category	Chassis
Last modified	23-May-2013 00:00:00
Symptom	301000 Service Brake System
Content	<p><u>Issue:</u> Excessive brake pedal pressure required to get the auto transmission out of park, warning lights on the instrument pack with associated DTC's for brake light switch (P0504-27, P0504-62, C1A96-64) or brakes showing signs of drag and binding.</p> <p><u>Cause:</u> Incorrect brake light switch setting. NOTE: Analysis of returned brake switches have shown no issues with the brake switch itself. Do not replace the switch before adjustment is carried out.</p> <p><u>Action:</u> Refer to TOPIx section 303-14 - General Procedures. Brake pedal position switch adjustment, to ensure that the brake light switch is correctly set prior to any other rectification being carried out.</p>