

## Damage to roof frame seal above windshield in area of mounts

Topic number	LI77.30-P-054046
Version	2
Design group	77.30 Vario roof, soft top - complete
Date	08-26-2013
Validity	Model series 172 up to VIN end number 172...1F025143
Reason for change	Damage codes adjusted
Reason for block	

### Complaint:

Damage to roof frame seal above windshield in area of mounts.

### Cause:

The locking pins can damage the roof frame seal above the windshield when the folding roof is being opened/closed.

### Remedy:

Replace seal on crossmember above windshield and replace both main guides.

The main guides are replaced in accordance with AR77.33-P-3506W.

The design of the main guides has been modified.

Vehicles are OK as of VIN end number 172...1F025143.

<b>Symptoms</b>
Body / Roof system / Convertible top/vario roof / Vario roof / Noise
Body / Roof system / Convertible top/vario roof / Vario roof / Leaks

<b>Parts</b>							
Part number	ES1	ES2	Designation	Quantity	Note	EPC	Other ma- ke part
A 172 720 00 78			Windshield sealing frame	1		X	
A 172 790 01 06			Left main guide	1		X	
A 172 790 02 06			Right main guide	1		X	

<b>Validity</b>		
Vehicle	Engine	Transmission

172.403	*	*
172.447	*	*
172.448	*	*
172.457	*	*
172.475	*	*

Full model designation breakdown		
Vehicle	Engine	Transmission
172.403	651.980	711.670
172.403	651.980	722.908
172.447	271.861	711.653
172.447	271.861	711.654
172.447	271.861	722.997
172.448	271.861	711.655
172.448	271.861	722.997
172.457	276.956	722.906
172.475	152.980	722.909