

## Window Switchpack Label.pdf

Reference	SSM64997
Models	Range Rover (All New) / L405
Title	Drivers Electric Window Switch Pack Inoperative
Category	Electrical
Last modified	01-May-2013 00:00:00
Symptom	205000 Electrical Accessories
Content	<p><b>Issue:</b> A customer may report a concern that the driver's window lift switch pack does not operate any of the windows when selected, however all other windows can be operated when selected at the individual door switch.</p> <p><b>Cause:</b> Switch pack software</p> <p><b>Action:</b> Should a customer express the concern please replace the driver's window lift switch pack. Please order part number LR034932 and ensure that the part being replaced has a part number label attached (please view attachment) printed with CPLA-14540-AC and marked with HW02 on the part number label. If not the part will need to be returned through the normal parts return process.</p> <p>Affected VIN range DA100000 to DA109841.</p>

