

Reference	SSM69538
Models	LR2 / L359 Range Rover Evoque / L538 Range Rover (All New) / L405
Title	Unable to save navigation co-ordinates
Category	Electrical
Last modified	07-Nov-2013 00:00:00
Symptom	207000 Entertainment Systems
Content	<p>Issue: A customer may report that they are unable to save navigation co-ordinates.</p> <p>Cause: Software compatibility issues</p> <p>Action: If a customer reports the concern detailed above an HLDF software update will be required using SDD. To complete the update follow the instructions below:-</p> <ul style="list-style-type: none"> -Ensure DVD 135 patch 9 or later is loaded -Connect the vehicle to a suitable power supply -Connect SDD to the vehicle -Start a new diagnostic session -Enter symptoms: Electrical - Information and entertainment system - Touch screen display -From the "Extras" tab select "Configure existing module - Front control/display interface module (high level display front)" -When complete end the session, and disconnect SDD. -Disconnect the power supply