TECHNICAL BULLETIN LTB00546NAS1 05 JUL 2013



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-10

Rear Seat Power Fold Feature Increase In Operational Time

AFFECTED VEHICLE RANGE:

Range Rover (LG)

Model Year:2013 OnwardsVIN:DA000001 Onwards

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The rear seat power fold function may not operate after the vehicle ignition has been switched 'OFF' for a period of three (3) minutes if the tailgate has been opened and a passenger compartment door has been opened and closed.

Cause: This may be caused by software issues.

Action: Should a customer express concern, follow the Service Instruction outlined below.

PARTS:

No Parts Required

TOOLS:

NOTE: This document is an 'Active Bulletin' that will display a functional programming shortcut if accessed within a diagnostic session using SDD.

IDS with latest IDS-DVD and Calibration File; first available on DVD134.02 v.134 Jaguar Land Rover-approved Midtronics battery power supply

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Run SDD 'Seats - rear 60/40 seat configuration' application	86.90.89/75	0.20	42	LR042870
\triangle NOTE: Normal Warranty policies and procedures apply.				

SERVICE INSTRUCTION:

1. CAUTION: A Jaguar Land Rover-approved Midtronics battery power supply must be connected to the vehicle battery during IDS / SDD diagnosis / module programming.

NOTE: IDS must be loaded with DVD134.02 v.134 or later.

Connect the Jaguar Land Rover-approved Midtronics battery power supply to the vehicle battery.

- 2. Turn ignition 'ON' (engine not running).
- **3.** Connect the Integrated Diagnostic System (IDS) to the vehicle and begin a new Symptom Driven Diagnostics (SDD) session.
- **4.** Follow the on-screen prompts, allowing SDD to read the VIN and identify the vehicle and initiating the data collect sequence.
- 5. Select 'Campaign' from the Session Type screen.
- Select the 'Recommendations' tab, and then select 'Run' to perform the 'Seats Rear 60/40 seat configuration' option.
- **7.** Follow all on-screen instructions to complete this task.
- 8. Exit the current session.
- **9.** Disconnect the IDS and the battery power supply from the vehicle.