



NUMBER: 08-003-13 REV. A

GROUP: Electrical

DATE: May 03, 2013

This bulletin is supplied as technical information only and is not an authorization for repair. No part of this publication may be reproduced, stored in a retrieval system, or transmitted, in any form or by any means, electronic, mechanical, photocopying, or otherwise, without written permission of DaimlerChrysler Corporation.

THIS BULLETIN SUPERSEDES SERVICE BULLETIN 08-003-13, DATED JANUARY 15, 2013, WHICH SHOULD BE REMOVED FROM YOUR FILES. ALL REVISIONS ARE HIGHLIGHTED WITH **ASTERISKS**** AND INCLUDES A NEW PART NUMBER FOR HIGH LINE TPM.**

SUBJECT:

Clock In The Radio Loses Time

OVERVIEW:

This bulletin involves replacing the Wireless Control Module (WCM)/Sentry Key Remote Entry Module (SKREEM).

MODELS:

2009 - 2012	(JK)	Wrangler
2009 - 2012	(KK)	Liberty
2009 - 2011	(KA)	Nitro

SYMPTOM/CONDITION:

Customer may experience a condition where the clock will lose over one minute a month.

DIAGNOSIS:

If the customer describes the symptom, perform the Repair Procedure.

PARTS REQUIRED:

Qty.	Part No.	Description
1 (AR)	68209969AA	SCREEM/WCM, With remote start (sales code XBM)
1 (AR)	68209837AA	SCREEM/WCM
1 (AR)	68209838AA	SCREEM/WCM, (International only)
1 (AR)	68209970AA	SCREEM/WCM, With Thatcham.(LS9 sales code)
1 (AR)	68223406AA	SCREEM/WCM, sales code (XGM)

REPAIR PROCEDURE

1. Replace the WCM/SCREEM, follow the remove and installation procedure per TechConnect: Vehicle Theft Security/MODULE, Sentry Key Immobilizer (SKREEM)/Removal/installation.
2. Make sure to read and follow all notes regarding key Transponders and Tire pressure sensor reprogramming.
3. Clear all codes that may have been set during the replacement procedure.

POLICY:

Reimbursable within the provisions of the warranty.

TIME ALLOWANCE:

Labor Operation No:	Description	Amount
08-80-28-91	Module, Screem, Replace (KK/KA) (2-Skilled)	0.5 Hrs.
08-80-28-91	Module, Screem, Replace (JK) (2-Skilled)	0.6 Hrs.

FAILURE CODE:

ZZ	Service Action
----	----------------